Preliminary Information

PIC6211A No Start/ No Propulsion DTC P0A0C

Product Investigation Review Required

Models

Brand:	Model:	Model Years:	VIN:		Engino	Transmissions:	
			from	to	Engine:	ransmissions:	
Chevrolet	Volt	2016 - 2018	All	AII	LKA	MKV	
Buick	Velite	2016 - 2018	All	All	All	5ET50	
Involved Region or Country:		North America, China					
Additional RPO/s:		L3A, MKA					
Condition:		Some customer may experience one or all of the following concerns: 1. No Start					
		2. Loss of propulsion while driving					
		3. Check Engine Lamp					
Cause:		After initial diagnosis the tech may find a current or history code P0A0C					

Correction:

Reprogram the Hybrid Powertrain Control Module 2 with the latest calibration in TIS-2-Web. The HPCM2 will then ignore the interlock circuit and P0A0C will no longer be a valid DTC for the vehicle.

Warranty Information

Labor Operation:	Description:	Labor Time:
2810265	Hybrid Powertrain Control Module 2 Reprogramming with SPS	Use Published Labor Operation Time

Version History

Version	2	
Modified	8/21/2017 - Update model years and repair procedure	



















