



Preliminary Information

PIC6339 Diagnostic Tip - Service Drivers Assist B290A

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	CT6	2018 - 2019	All	All	All	All

Involved Region or Country	North America
Additional Options (RPO)	UKL
Condition	Service Drivers Assist message With a B290A SYM49
Cause	Steering wheel Lane Centering Indicators Ram Error

Correction:

If a B290A SYM49 is found to be setting current, it will be necessary to unplug the Steering Column Friction Control Module (SCFCM) and recheck the status of the DTC.

If after unplugging the SCFCM the B290A remains current, the Steering Wheel will require replacement. If the B290A changes to history, the Steering Column Friction Control Module will require replacement.

Please refer to the latest version of [PIC6307](#) - Super Cruise TAC Part Restriction

Version History

Version	1
Modified	9/14/2018 - Created



GENERAL MOTORS