



## Preliminary Information

### PIP5159C Engine Misfire May Be Due To Loose Spark Plug Wires Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	CTS-V	2016 - 2019	All	All	6.2L LT4	All
Cadillac	Escalade	2015 - 2019	All	All	6.2L L86	All
Chevrolet	Camaro	2016 - 2019	All	All	6.2L LT1 LT4	All
Chevrolet	Corvette	2016 - 2019	All	All	6.2L LT1 LT4 LT5	All
Chevrolet	Silverado	2014 - 2019	All	All	4.3L, 5.3L, 6.2L LV3 L83 L86	All
Chevrolet	Suburban	2015 - 2019	All	All	5.3L, 6.2L L83 L86	All
Chevrolet	Tahoe	2015 - 2019	All	All	5.3L, 6.2L L83 L86	All
GMC	Sierra	2014 - 2019	All	All	4.3L, 5.3L, 6.2L LV3 L83 L86	All
GMC	Yukon	2015 - 2019	All	All	5.3L, 6.2L L83 L86	All

#### Supersession Statement

This PI was superseded to update Model Years. Please discard PIP5159B.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

#### Condition / Concern


**SES lamp on, DTC P0300 - P0308 may set, inspect for a possible loose sparkplug wire at the ignition coil.**

#### Recommendations / Instructions

**If a loose sparkplug wire is found, inspect for missing "C" clip on wire end that connects to the ignition coil.**

**Replace the sparkplug wire if you find the "C" clip missing or damaged.**

**If this concern is not found reconnect the sparkplug wire to the ignition coil.**

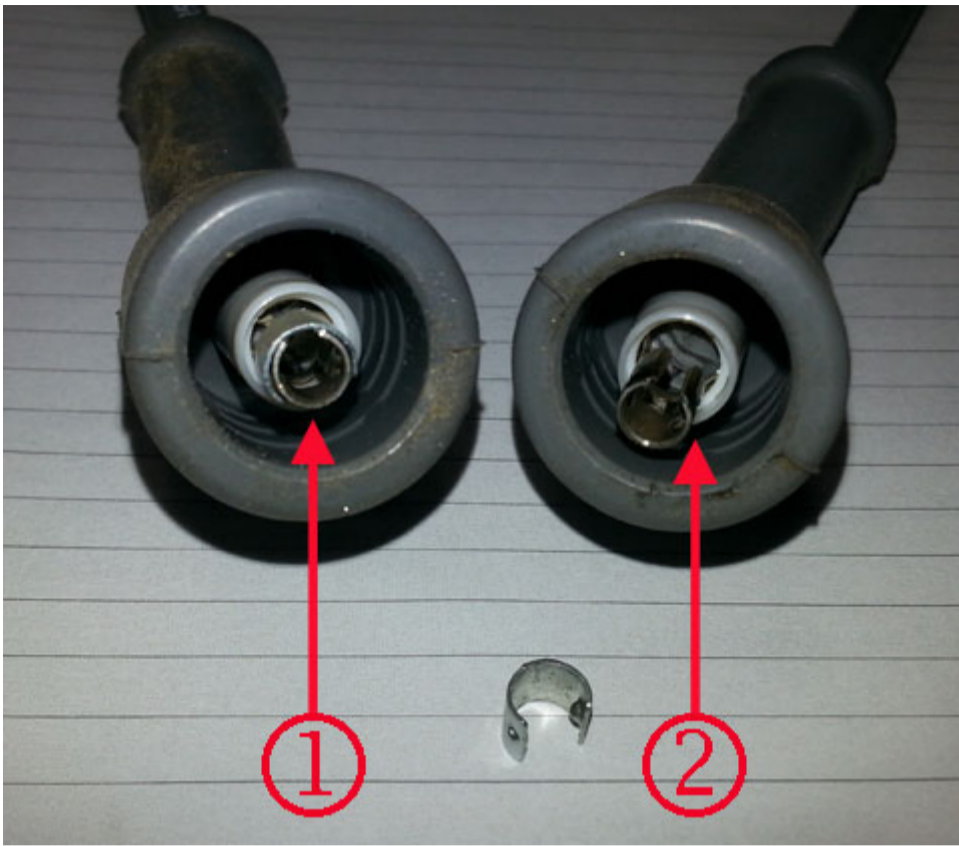

**1. Shows a good sparkplug wire.**

**2. Shows the wire with the C clip missing.**

Warranty Information

**For vehicles repaired under warranty, use:**

Labor Operation	Description	Labor Time
4020050	Spark Plug Wire Replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.



GENERAL MOTORS

© 2018 General Motors. All Rights Reserved.