



# Preliminary Information

## PIT5608B GMC Terrain/Chevy Equinox Seat movement, door lock cycle possible B3125, B3130 or B3135 stored

Product Investigation Review Required

### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Equinox	2018 - 2019	All	All	All	All
GMC	Terrain	2018 - 2019	All	All	All	All

<b>Involved Region or Country:</b>	<b>North America</b>
<b>Additional RPO/s:</b>	<b>None</b>
<b>Condition:</b>	<b>Some customers may comment that they hear the door locks cycle on their own, their seat may move randomly without command, problems with the mirror adjustment switches or intermittent PEPS operation.</b>
<b>Cause:</b>	<b>Short circuit in one or more of the following connectors X500, x600, x700 or x800 due to water intrusion</b>

### Correction:

Check the condition of the x500, x600, x700 or x800 connectors and the mating body harness for signs of water intrusion. Repair as necessary.

Evaluate the A-pillar body plug to ensure it is present and sealing properly. Engineering is investigating this sealing issue. If no concerns are observed refer to SI for further diagnosis.

### Version History

Version	3
	03/23/2018 - Created on 07/03/18 - Updated to add DTC information. 10/30/2018 - Updated to add 2019 model year.



GENERAL MOTORS