



Bulletin No.: PIP5606A

Published date: N/A

Preliminary Information

PIP5606A Ticking Noise From The Engine

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500 (New Model)	2019	All	All	5.3L 6.2L L84 L86	All
GMC	Sierra 1500 (New Model)	2019	All	All	5.3L 6.2L L84 L86	All

Involved Region or Country	North America
Condition	A vehicle may have a tick noise from the engine cold, initial start in the morning
Cause	A lifter may not have sufficient amount of oil during cold start operation (not pumped up)

Correction:

Allow engine to run for 20-30 mins.

If the noise is gone release the vehicle back to the customer.

Drive the vehicle through the DFM modes.

Check for any misfire DTC and record. If DTC is found refer to SI for diagnosis

If noise is still persists, operate the engine thru cylinder Deactivation test to isolate the cylinder with the concern.

If isolated inspect for a bent pushrod and/or collapsed lifter then, replace as necessary.

Engineering is working to understand cause for this concern.

As analysis from returned parts is completed, PI will be updated accordingly. When the final repair is confirmed this PI will be changed to a Bulletin

Warranty Information

Labor Operation	Description	Labor Time
Use Published Labor Operation For The Repair	Lifter Replacement or Diagnostics	Use published Labor Times
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	2
Modified	10/30/2018 - Created 11/02/2018 - Updated to add engine run time.



GENERAL MOTORS

© 2018 General Motors. All Rights Reserved.