



TECHNICAL SERVICE BULLETIN

Illuminated Malfunction Indicator Lamp (MIL) With Diagnostic Trouble Code (DTC) U301D - Built On Or Before 2-Oct-2018

18-2386
20 December
2018

Model:

Ford 2019 Fusion

Issue: Some 2019 Fusion Energi vehicles built on or before 2-Oct-2018 may exhibit an illuminated MIL with DTC U301D in the battery energy control module (BECM) after a charging event.

Action: Follow the Service Procedure steps to correct the condition.

Warranty Status: Eligible Under Provisions Of New Vehicle Limited Warranty Coverage And Emissions Warranty Coverage Warranty/ESP coverage limits/policies/prior approvals are not altered by a TSB. Warranty/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
2019 Fusion Energi: Retrieve DTCs And Reprogram The Appropriate Modules As Required By The Software Update Includes Time To Clear Codes After Repair (Do Not Use With Any Other Labor Operations)	182386A	0.5 Hrs.

Repair/Claim Coding

Causal Part:	10B687
Condition Code:	04

Service Procedure

- Check the vehicle build date. Was the vehicle built on or before 2-Oct-2018?
 - Yes - proceed to step 2.
 - No - this article does not apply. Refer to the Powertrain Controls/Emission Diagnosis (PC/ED) Manual for normal diagnostics.
- Using the appropriate Ford diagnostic tool or equivalent, retrieve DTCs. Is DTC U301D the only DTC stored in the BECM?
 - Yes - reprogram the powertrain control module (PCM) and BECM to the latest calibration using the latest software level of the appropriate Ford diagnostic scan tool. The BECM is programmed as part of the coordinated reprogram.
 - No - this article does not apply. Refer to the PC/ED Manual for normal diagnostics.

© 2018 Ford Motor Company
All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.