

Preliminary Information

PIP5503A Diagnostic Tips for Engine Vibration

Models

Brand:	Model:	Model Years:	VIN:		Engine	Transmissions:
			from	to	Engine:	Transmissions.
Cadillac	CTS-V	2016 - 2019	All	All	6.2L LT4	All
Cadillac	Escalade	2015 - 2019	All	All	6.2L L86	All
Chevrolet	Camaro	2016 - 2019	All	All	6.2L LT1, LT4	All
Chevrolet	Silverado	2014 - 2018	All	All	4.3L LV3 5.3L L83 6.2L L86	All
Chevrolet	Silverado LD	2019	All	All	4.3L LV3 5.3L L83 6.2L L86	All
Chevrolet	Suburban	2015 - 2019	All	All	5.3L L83	All
Chevrolet	Tahoe	2015 - 2019	All	All	5.3L L83	All
GMC	Sierra	2014 - 2018	All	All	4.3L LV3 5.3L L83 6.2L L86	All
GMC	Sierra Limited	2019	All	All	4.3L LV3 5.3L L83 6.2L L86	All
GMC	Yukon	2015 - 2018	All	All	5.3L L83 6.2L L86	All

Involved Region or Country	North America		
Condition	Customer may have a concern with an engine vibration, this vibration may occur when vehicle is stationary or accelerating from a stop.		
Cause	It may be found that engine oil was recently changed. Engine oil overfilled.		

Correction:

If the above concern is encountered, it is recommended to check the engine oil level (refer to vehicle owner's manual for details on correctly checking engine oil level).

A vibration caused by a crankcase overfilled with engine oil will typically display Engine 1 (E1) as the dominant vibration when monitored with the PICO Scope.

If the engine oil level is confirmed to be overfull, verify if the crankcase was overfilled with engine oil or is contaminated by an outside substance such as fuel or coolant.

If the engine was overfilled with only engine oil, adjust the oil level and re-evaluate the concern (possibly the result of the engine oil having been overfilled during an oil change or maintenance service).

If the engine oil level was overfull as a result of contamination, determine the source of the contamination and repair as

NOTE: As further information becomes available this PI will be updated or replaced with a bulletin as needed.

Version History

Version	2
Modified	06/14/2017 - Created
Modified	12/10/2018 - Updated to include 2018 and 2019 model years and add clarity to Correction.















