

# **Preliminary Information**

# PIT5363E Click or Tick Noise Heard Inside Cab with Engine Running

## Models

Brand:	Model:	Model Years:	VIN:		Engine	Transmissions:
			from	to	Engine:	Hansinissions.
Chevrolet	Colorado	2015 - 2019	All	All	All	All
GMC	Canyon	2015 - 2019	All	All	All	All

#### **Supersession Statement**

This PI was superseded to update Model Years and apply to all engines. Please discard PIT5363D.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this Pl.

#### Condition / Concern

Important: A tick noise is characteristic of Direct Injected Engines. Please refer to the latest version of 07-06-04-025 for additional information.

A customer or technician may comment of engine or High Pressure Fuel Pump tick noise that is very loud in the cab of the truck.

Comparison with another truck having the same powertrain could show the other truck is quieter.


#### Recommendations / Instructions

During vehicle build a possibly exists that an acoustic seal was knocked out of place during assembly.

With this acoustic seal dislodged or missing the High Pressure Fuel pump tick / click noise can be heard easily inside the cab of the truck.

If the seal is missing replace it with one from Kit Part Number 23135690. Reference the Blower Upper Case Replacement section of SI to assist with seal replacement.

**Seal Missing** 

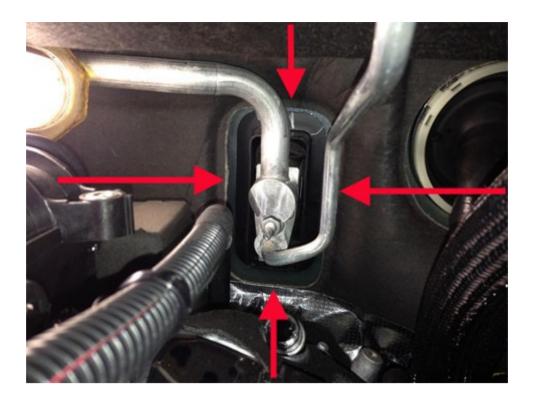

#### **Seal Present**



# **Parts Information**

Part Number Description		Qty
23135690	SEAL KIT, A/C EVPR TXV	1

## **Warranty Information**

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

<b>Labor Operation</b>	Description	Labor Time	
4411970	Heater Case Replacement	Use Published Labor Operation Time	

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

















# GENERAL MOTORS

© 2019 General Motors. All Rights Reserved.