



Technical Service Bulletin

94 Sequential turn signals do not work

94 19 10 2055350/1 June 26, 2019.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
Q5	2019	000001 - 037474	With LED rear combination lamp

Condition

Customer states:

- The sequential turn signals do not work on the rear taillights.
- The static turn signals work.

Workshop findings:

- There are no DTCs logged.

Technical Background

The sequential turn signals parameters were incorrectly implemented into the comfort system central control module, J393 (address word 0046).

Production Solution

Updated ZDC in the comfort system central control module, J393 (address word 0046).

Service

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the ZDC in the comfort system central control module, J393 (address word 0046) using the SVM action code as listed in the table below, if necessary:



Technical Service Bulletin

Model	Old ZDC Number	Old ZDC Version	New ZDC number	New ZDC Version (or higher)	SVM Code Input
Q5	80B909501H	*	80B909501H	0038	46A025

Warranty

Claim Type:	<ul style="list-style-type: none">• 110 up to 48 Months/50,000 Miles.• G10 for CPO Covered Vehicles – Verify Owner.• If the vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	5789		
Damage Code:	0039		
Labor Operations:	Software Update	0151 0000	Time stated on the diagnostic protocol (Max 70 TU)
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to the service procedure	No allowance	0 TU
	Road test after the service procedure	No allowance	0 TU
Claim Comment:	As per TSB #2055350/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732, *00 Software Version Management (SVM), operating instructions*.

All part and service references provided in this TSB (2055350) are subject to change and/or removal. Always check with your Parts Department and/or ETKA for the latest information and parts bulletins. Please check the Repair Manual for fasteners, bolts, nuts, and screws that require replacement during the repair.



Technical Service Bulletin

©2019 Audi of America, Inc. All rights reserved. The information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.