

- ATTENTION:**
- GENERAL MANAGER
 - PARTS MANAGER
 - CLAIMS PERSONNEL
 - SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.

©2019 Subaru of America, Inc. All rights reserved.



QUALITY DRIVEN® SERVICE

SERVICE INFORMATION BULLETIN

APPLICABILITY: 2014-18MY Forester Turbo
2015-19MY WRX

NUMBER: 02-182-19

DATE: 05/28/19

SUBJECT: Tumble Generator Valve (TGV) -Design Change
Related DTCs: P2004, 2005, 2006 and /or P2007

INTRODUCTION:

This Service Information bulletin announces a design change made to the TGV assemblies used on the models listed above. Condensation resulting from EGR system operation may enter the area between the TGV shaft and bearing. Over time, corrosion can develop and impede movement of the TGV shaft and cause any of the DTCs P2004, 2005, 2006 and /or P2007 to set. The material of the TGV shaft has been changed to stainless steel to optimize corrosion resistance.

PRODUCTION CHANGE INFORMATION:

The new TGVs were incorporated into WRX production starting with VIN K9817040.


PART INFORMATION:

Description	Part Number	Application
MANIFOLD ASSY-INTAKE CONTROL	14111AA041	Right Side- ALL
	14111AA051	Left Side- ALL

REMANDER: Always order the most up-to-date replacement parts based on the specific VIN being repaired.

SERVICE PROCEDURE / INFORMATION:

REMANDER: Customer satisfaction and retention starts with performing quality repairs.

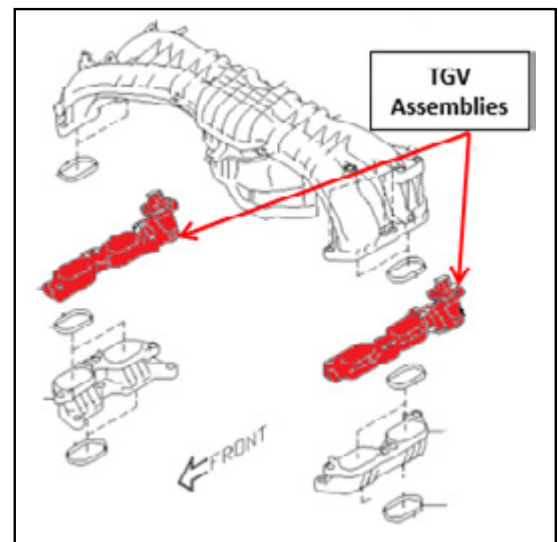

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

Subaru of America, Inc. is ISO 14001 Compliant

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

Continued...

The service procedures for replacing the TGV assemblies remain unchanged. Always refer to the applicable Service Manual and review the full requirements of the repair being performed. The Service Manual procedures contain information critical to performing an effective repair the first time and every time. This includes but is not limited to: important SAFETY precautions, proper inspection criteria, necessary special tools, required processes and related one-time-use parts needed for a complete and lasting repair.

IMPORTANT REMINDERS:

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.