



Bulletin No.: PIT5693  
Published date: 06/24/2019

## Preliminary Information

### PIT5693 Service Air Bag, Park Brake, Stabilitrack or Park Brake Light

Product Investigation Review Required

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Blazer	2019	All	All	All	All

<b>Involved Region or Country</b>	<b>North America</b>
<b>Condition</b>	<b>Some customers may complain of any of the following conditions: Air bag Light Service Stabilitrack, Service Park Brake and/or Steering Assist Message displayed. You may also find any of the following DTC's set: B101E, U0077, U0131, U0151, U0232, U0415, U0422, U1510, U2415 or other communication codes.</b>
<b>Cause</b>	<b>The cause of this condition may be due to the IP harness being pinched behind center console metal side brace on the left side of the console, causing a wire short.</b>

#### **Correction:**

**Remove the left side Front Floor Console Extension Panel and inspect for the harness being pinched behind the vertical metal side brace in the area shown below.**



**If a pinch condition is found repair the wiring following the proper procedure in SI and ensure that the harness is not contacting the brace upon reassembly .**

### Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
5480698	Remove the left side Front Floor Console Extension Panel and Inspect wiring harness for being pinched.	ST
<b>*This is a unique Labor Operation for Bulletin use only.</b>		

### Version History

Version	1
Modified	06/24/2019 - Created on



© 2019 General Motors. All Rights Reserved.