


Preliminary Information


PIT5530C Remove Tinnerman Push Nuts Prior to Installation or During Service of Accessory/Production 22" Wheels - Induced Vibration

<u>Models</u>


Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to	Engine.	
Cadillac	Escalade	2015 - 2019	All	All	All	All
Chevrolet	Silverado 1500	2014 - 2018	All	All	All	All
Chevrolet	Suburban	2015 - 2019	All	All	All	All
Chevrolet	Tahoe	2015 - 2019	All	All	All	All
GMC	Sierra 1500	2014 - 2018	All	All	All	All
GMC	Yukon	2015 - 2019	All	All	All	All


Involved Region or Country	North America and N.A. Export Regions	
Additional Options (RPO)	I Options Equipped with Accessory 22" Wheels (RPO SES, SEU, SEY, OR SEZ) production 22" wheels (RPO RPT or SMI), shown below.	

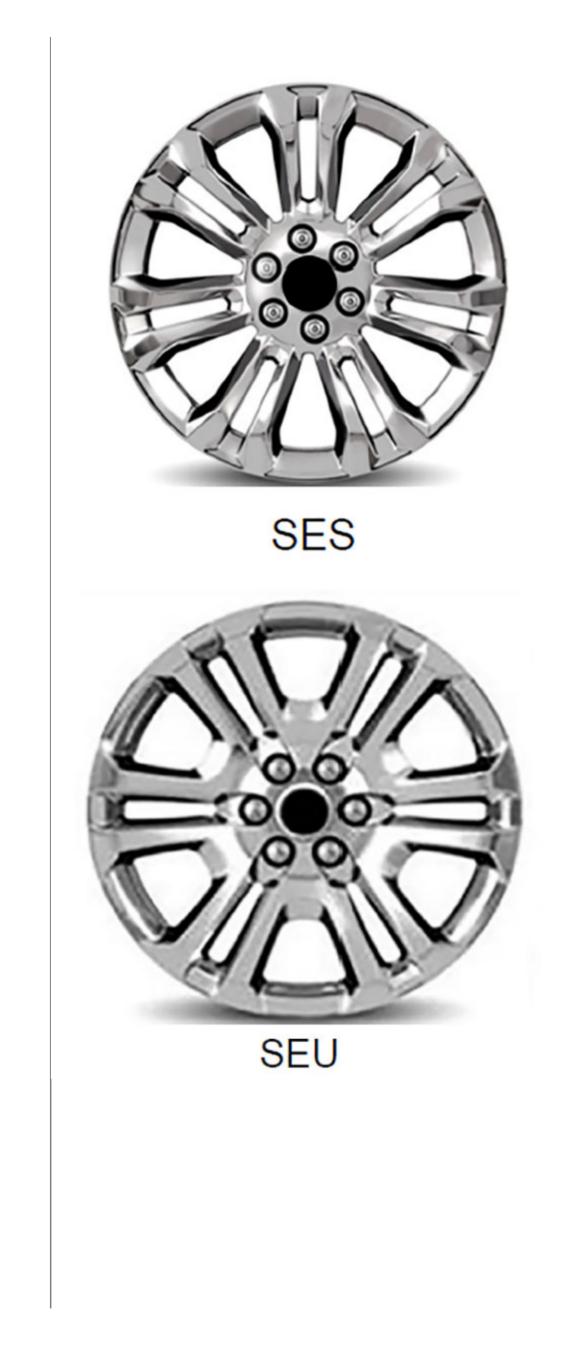

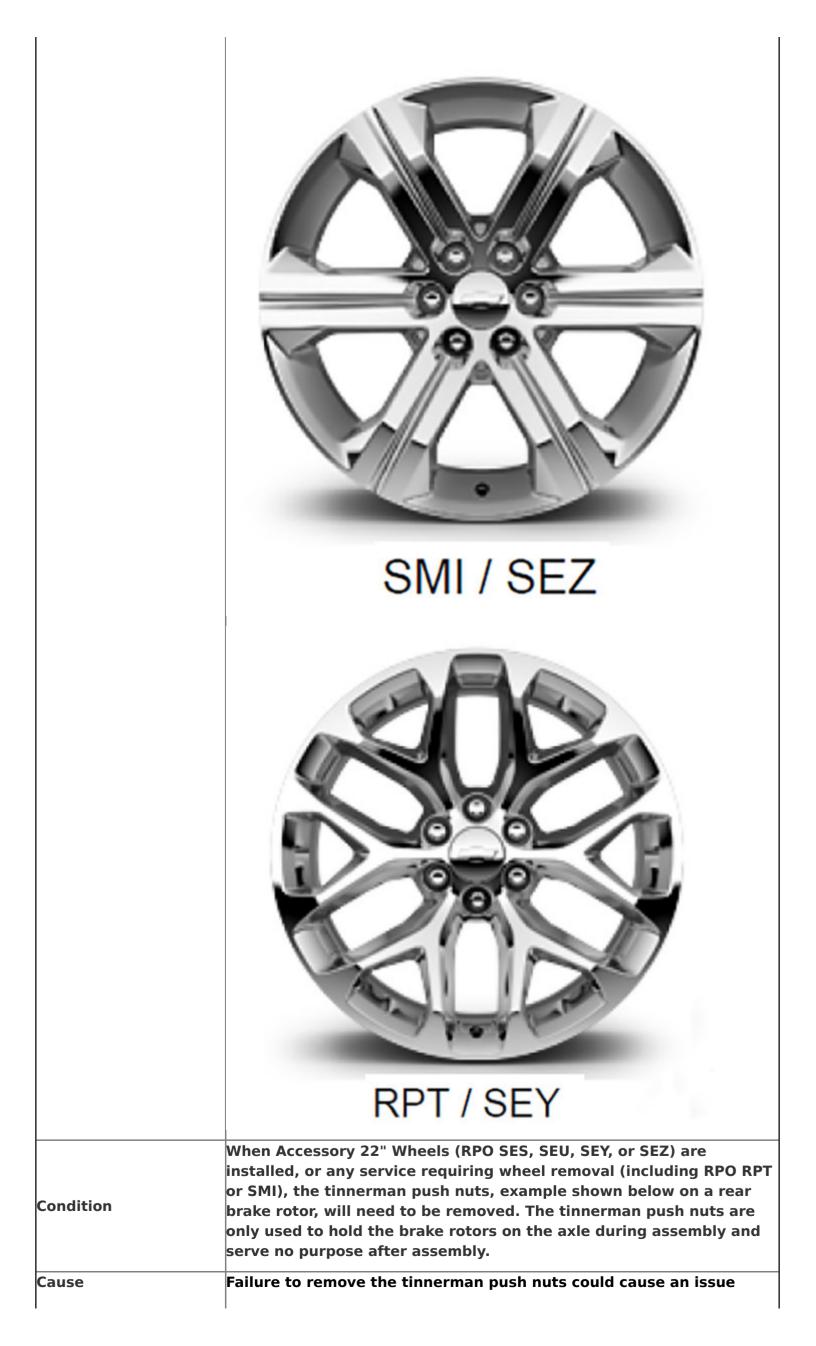

where the wheel will no longer be flush when it is mounted to the			
rotor hub face and secured. This may create lateral runout, inducing			
_a vibration.			

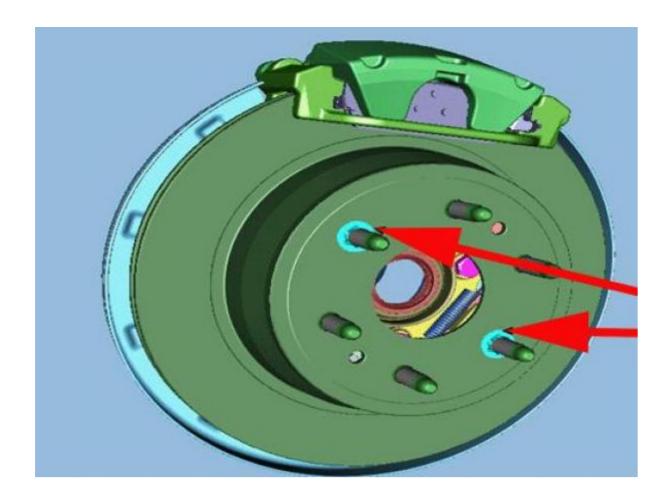

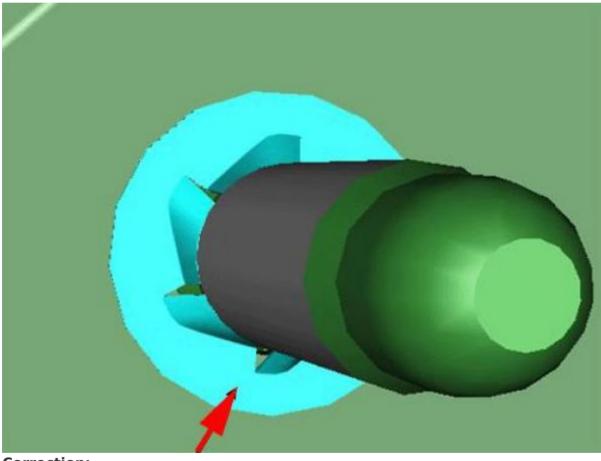

Correction:

Prior to the installation of GM Accessory Wheels (RPO SES, SEU, SEY, or SEZ) or during service of production 22" wheels (RPO RPT or SMI), make sure that the tinnerman nuts have been removed and discarded. If diagnosing a vibration concern and the vehicle is equipped with these accessory/production wheels, inspect to make sure the tinnerman nuts have been removed.

Additional SI Keywords

GM Part Number 19301158, 19301156, 19301157, 19301159, 20939930, 20939931

Version History

Version	4
Modified	11/30/2016 Created on
	01/09/2017- Updated to add additional wheel RPO's
	03/26/2018 - Updated to add the 2018 models
	06/25/2019 - Updated to add 2019 models



L

© 2019 General Motors. All Rights Reserved.