

Bulletin No.: PIT5608C Published date: 06/28/2019

Preliminary Information

PIT5608C GMC Terrain/Chevy Equinox Seat movement, door lock cycle possible B3125, B3130 or B3135 stored

Product Investigation Review Required

<u>Models</u>

Brand:	Model:	Model Years:	VIN:		Enginet	Transmissions:	
			from	to	Engine:	Transmissions.	
Chevrolet	Equinox	2018 - 2020	All	All	All	All	
GMC	Terrain	2018 - 2020	All	All	All	All	
Involved Region or Country:		North America					
Condition:		Some customers ma on their own, their s problems with the r PEPS operation.	seat may	/ mov	e randomly		
Cause:	I	Short circuit in one x600, x700 or x800				connectors X500,	

Correction:

Check the condition of the x500, x600, x700 x800 connectors and the mating body harness for signs of water intrusion. Repair as necessary.

Evaluate the A-pillar body plug to ensure it is present and sealing properly. Engineering is investigating this sealingsue. If no concerns are observed refer to SI for further diagnosis.

Version History

Version	4		
	03/23/2018 - Created on		
	07/03/2018 - Updated to add DTC information.		
Modified	10/30/2018 - Updated to add 2019 model year.		
	06/28/2019 Updated to add 2020 Model year.		



GENERAL MOTORS

© 2019 General Motors. All Rights Reserved.