



Preliminary Information

PIT5760 Passenger Side HVAC Blows Warm After Performing Bulletin 17-NA-293

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Envision	2016 - 2017	All	All	All	All

Involved Region or Country:	North America
Additional RPO/s:	CJ4
Condition:	Passenger side A/C blows warm after performing bulletin 17-NA-293.
Cause:	Temperature sensor connectors swapped during service.

Correction:

Refer back to the illustrations in bulletin [17-NA-293](#) and the Important information in red. Check the wire colors in the connectors for the Evaporator Temperature Sensor and the Right Vent temp Sensors. If they are swapped the controller will always think the right side is too cold and command the temperature door to hot.

Warranty Information

There is no applicable warranty operation for this repair.

Version History

Version	1
Modified	07/29/2020 - Created on.



GENERAL MOTORS