

ATTENTION:

GENERAL MANAGER

PARTS MANAGER

CLAIMS PERSONNEL

SERVICE MANAGER

IMPORTANT - All Service Personnel Should Read and Initial in the boxes provided, right.

© 2020 Subaru of America, Inc. All rights reserved.



QUALITY DRIVEN® SERVICE

SERVICE BULLETIN

APPLICABILITY: 2013-14MY Legacy and Outback
 2015MY Impreza
 2015MY Crosstrek

NUMBER: 06-80-20

DATE: 10/08/20

SUBJECT: DTC C0075 Repair Information

INTRODUCTION:

This bulletin announces a change to the internal logic of the ABS / VDC Hydraulic Control Unit. The change was made to address isolated concerns of the ABS and / or VDC warning lamp(s) coming on in error and setting a DTC C0075: <WHEEL CYLINDER PRESSURE SENSOR OUTPUT> in memory. A logic change was made to optimize the failure detection criteria. The repair involves replacement of the ABS / VDC Hydraulic Control Unit as the unit's software cannot be reprogrammed.

PART INFORMATION:

REMINDER: Always order the most up-to-date replacement parts based on the specific VIN being repaired.

Description	Part Number	Application
HYDRAULIC UNIT ASSY V/CONT	27596AJ04C	2013-14MY Legacy / Outback
	27596FJ231	2015MY Impreza / Crosstrek

SERVICE PROCEDURE / INFORMATION:

REMINDER: Customer satisfaction and retention starts with performing quality repairs.

VERY IMPORTANT: Service Manual diagnosis for C0075 **MUST** be completed to rule out other possible cause(s) for the DTC BEFORE replacing the ABS / VDC Hydraulic Control Unit.

The service procedures for replacing the ABS / VDC Hydraulic Control Unit remain unchanged. Always refer to the applicable Service Manual and review the full requirements of the repair being performed. The Service Manual procedures contain information critical to performing an effective repair the first time, every time. This includes but is not limited to important SAFETY precautions, proper inspection criteria, necessary special tools, required processes needed for a complete and lasting repair.

CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

Subaru of America, Inc. is ISO 14001 Compliant

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

Continued...

WARRANTY / CLAIM INFORMATION:

For vehicles within the Basic New Car Limited Warranty period or covered by an active Subaru Added Security Classic or Gold plan, this repair may be submitted using the following claim information:

Labor Description	Labor Operation #	Labor Time	Fail Code
ABS/VDC HYDRAULIC CONTROL UNIT R&R	B536-301	1.2	QCP-42
ABS/VDC SYSTEM TESTING & DIAGNOSIS	C566-300	0.5	

IMPORTANT REMINDERS:

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.