



Preliminary Information

PIP5763 Service Rear Axle Message with DTC C1135 SYM92

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	CT5-V	2020 - 2021	ALL	ALL	LGY	MHS

Involved Region or Country	North America
Additional Options (RPO)	RPO G96 Differential, Electronic Limited Slip
Condition	Some customers may comment that there is a Service Axle message displayed and possible loss of limited slip differential function.
Cause	This condition occurs when C1135 symptom byte 92 is set in the K164 Differential Control Module (DCM)

Correction:

Engineering has identified a software anomaly that causes the DTC to set prematurely. If code C1135.92 is in History, clear codes using GDS2 and take no further action. Do not replace the K164 Differential Control Module.

A revised calibration will be available in the December 2020 timeframe to address this condition.

A Bulletin will be released to replace this PI when the calibration is available

Note: If the DTC is Current, continue with published Service Information diagnostics.

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
3087178	Differential Control Module - Clear DTC C1135 SYM92	.3 Hr.
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	1
Modified	11-13-2020 - Created on.



GENERAL MOTORS

© 2020 General Motors. All Rights Reserved.