

Bulletin No.: PIC6421 Published date: 11/16/2020

Preliminary Information

PIC6421 Hood Latch Replacement Tip

<u>Models</u>

Brand:	Model:		Model Years:	VIN:		Engine	Transmissions:	
Di di lu.				from	to	Engine:	Transmissions.	
Chevrolet	Camaro		2016 - 2018	All	All	All	All	
Involved Region or Country		North America						
Additional Options (RPO)								
Condition		When replacing the hood latch on one of the vehicles listed above, the service replacement part # 84678990 will also require the use of connector # 19368220. This new service latch has a three-wire connector while the original latch part # 84053842 on model years 2016-2018 will only have a two-wire connector.						
Cause		Standardization of parts to service all 2016-2020 vehicles.						

Correction:

Obtain connector part # 19368220 as per EPC

Remove the yellow wire and terminal from the new connector part # 19368220. It is also acceptable to cut the wire 1-2" from the connector and tape the end of it off.

The schematic in SI shows a purple wire on the latch- on the new connector this is a red wire. Connect the red wire on the connector to the BN/GN wire in the vehicle harness.

Connect the black wire on the connector to the black wire on the vehicle harness.

Additional SI Keywords

hood, circuit, circuits, connector, latch, three, terminal, terminals, two, wire, wires,

<u>Version History</u>

Version	1
Modified	11/16/2020 - Created on.



GENERAL MOTORS

 $\ensuremath{\mathbb{C}}$ 2020 General Motors. All Rights Reserved.