 
#### ATTENTION:

GENERAL MANAGER PARTS MANAGER CLAIMS PERSONNEL SERVICE MANAGER

IMPORTANT - AII Service Personnel Should Read and Initial in the hoxes provided, right.



© 2016 Subaru of America, Inc. All rights reserved.

SUBARU

QUALITY DRIVEN® SERVICE

# SERVICE BULLETIN

APPLICABILITY: 2015-16MY Legacy and Outback Models

2015-16MY WRX Models

**DATE:** 02/08/16

**NUMBER:** 07-106-16

SUBJECT: DTC P1C00 / Change to Battery Sensor


### INTRODUCTION:

This bulletin announces a change to the battery sensor to prevent unnecessary occurrence of DTC P1C00 being set / stored in the ECM memory.

# PRODUCTION CHANGE INFORMATION:

The new battery sensor was incorporated into production as per the chart below:

VEHICLE / MODEL	ENGINE	STARTING VIN	
Legacy	2.5L	G*017229	
	3.6L	G*017228	
Outback	2.5L	G*237404	
	3.6L	G*237414	
WRX	2.0L	G*818262	

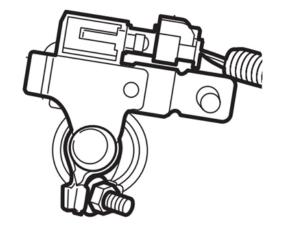

### PART INFORMATION:

DESCRIPTION	PART Number	APPLICATION	
SENSOR-BATTERY	29182AA01B	Legacy / Outback	
	29182AA011	WRX	

### **SERVICE PROCEDURE / INFORMATION:**

Although DTC P1C00 alone does NOT cause the Check Engine light to come on, it will likely be found when checking for any stored DTCs in the ECM. If the battery sensor is not replaced after identifying a stored P1C00, it will reset after clearing the memory on the next key cycle. When P1C00 is found in memory of a vehicle built prior to the production change, replace the battery sensor following the procedure in the applicable Service Manual.

Continued...

### **CAUTION: VEHICLE SERVICING PERFORMED BY UNTRAINED PERSONS COULD** RESULT IN SERIOUS INJURY TO THOSE PERSONS OR TO OTHERS.

Subaru Service Bulletins are intended for use by professional technicians ONLY. They are written to inform those technicians of conditions that may occur in some vehicles, or to provide information that could assist in the proper servicing of the vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do the job correctly and safely. If a condition is described, DO NOT assume that this Service Bulletin applies to your vehicle, or that your vehicle will have that condition.

#### SUBARU OF AMERICA, INC. IS **ISO 14001 COMPLIANT**

ISO 14001 is the international standard for excellence in Environmental Management Systems. Please recycle or dispose of automotive products in a manner that is friendly to our environment and in accordance with all local, state and federal laws and regulations.

### **WARRANTY / CLAIM INFORMATION:**

For vehicles within the Basic New Car Limited Warranty period or covered by a Subaru Added Security Classic or Gold plan, this repair may be submitted using the following claim information:

LABOR DESCRIPTION	LABOR	FAIL	LABOR
	OPERATION #	CODE	TIME
BATTERY AMP SENSOR R&R	A800-132	FAF-42	0.2

## **IMPORTANT REMINDERS:**

- SOA strongly discourages the printing and/or local storage of service information as previously released information and electronic publications may be updated at any time.
- Always check for any open recalls or campaigns anytime a vehicle is in for servicing.
- Always refer to STIS for the latest service information before performing any repairs.

Bulletin Number: 07-106-16; Date: 02/08/16