



Preliminary Information

PIP5803A Inspection Loose Upper Bolt For Timing Chain Guide Oil Leak Front Timing Cover Removal 2.0 LTG


Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Buick	Envision	2016 - 2021	All	All	2.0 LTG, 2.5 LCV	All
Buick	Regal	2016 - 2017	All	All	2.0 LTG	All
Cadillac	ATS	2016 - 2018	All	All	2.0 LTG	All
Cadillac	CT6	2016 - 2018	All	All	2.0 LTG	All
Cadillac	CTS	2016 - 2018	All	All	2.0 LTG	All
Chevrolet	Blazer	2019 - 2021	All	All	2.5 LCV	All
Chevrolet	Camaro	2016 - 2021	All	All	2.0 LTG	All
Chevrolet	Colorado	2016 - 2021	All	All	2.5 LCV	All
Chevrolet	Impala	2016 - 2018	All	All	2.5 LCV	All
Chevrolet	Equinox	2018 - 2021	All	All	2.0 LTG	All
Chevrolet	Malibu	2016 - 2021	All	All	2.0 LTG	All
Chevrolet	Traverse	2018 - 2019	All	All	2.0 LTG	All
GMC	Acadia	2017 - 2021	All	All	2.5 LCV	All
GMC	Canyon	2016 - 2021	All	All	2.5 LCV	All
GMC	Terrain	2018 - 2021	All	All	2.0 LTG	All

Involved Region or Country	North America
Condition	If a technician is making a repair that requires the front timing cover to be removed and finds the timing chain guide upper bolt (circled) loose enough to turn by hand, replace the timing chain guide and bolts.
Cause	The cause of this loose bolt has not been determined yet and is being investigated by engineering.

Correction:

Replace the timing chain guide and bolts.

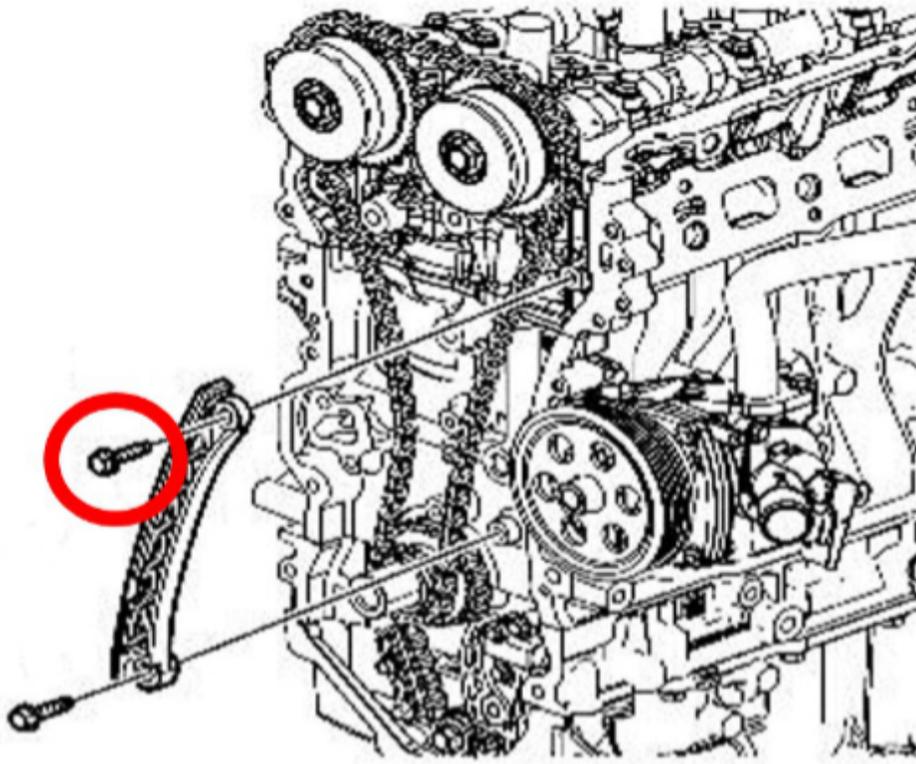

Parts Information

Description	Part Number	Quantity
Guide, Timing Chain Assy	12627111	1

Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable W arranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4087958	Timing Chain Guide Assembly Replacement	0.4 Hr.
*This is a unique Labor Operation for Bulletin use only.		

Version History

Version	2
Modified	04/09/2021 - Created. 04/19/2021 - Updated to add models and model years.



GENERAL MOTORS