



# Service Bulletin


Bulletin No.: 20-NA-121

Date: May, 2021

## TECHNICAL

**Subject:** Water Leak at Roof Area, Various Electrical Issues, No Start, Stall, Brake Lamp Not Off, Radio Inoperative, Remote Key Inoperative, TPM Light Illuminated, Malfunction Indicator Lamp (MIL) Illuminated with Possible DTCs C0750 SYM29, C0755 SYM29, C0760 SYM29, C0765 SYM29

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Buick	Encore GX	2020	2021	—	—	All	All
Chevrolet	Trailblazer (VIN M)	2021	2021			All	All

<b>Involved Region or Country</b>	North America
<b>Condition</b>	<p>Some customers may comment on one or more of the following conditions:</p> <ul style="list-style-type: none"> <li>Water leak in the front and/or rear of the vehicle (water found under A-pillar and B-pillar trim or in the spare tire area).</li> <li>Various electrical concerns</li> <li>No Start/Vehicle Stall</li> <li>Brake lamps will not shut off</li> <li>Radio inoperative</li> <li>Remote key inoperative</li> <li>Tire Pressure Monitor (TPM) light illuminated</li> <li>Malfunction Indicator Lamp illuminated</li> </ul> <p><b>Note:</b> Possible DTCs found, but not limited to: C0750 SYM29, C0755 SYM29, C0760 SYM29, C0765 SYM29</p>
<b>Cause</b>	

 
5703536



5703537




5703539



5613596

The cause of the condition may be a pin hole in the roof body seam welding/sealing.

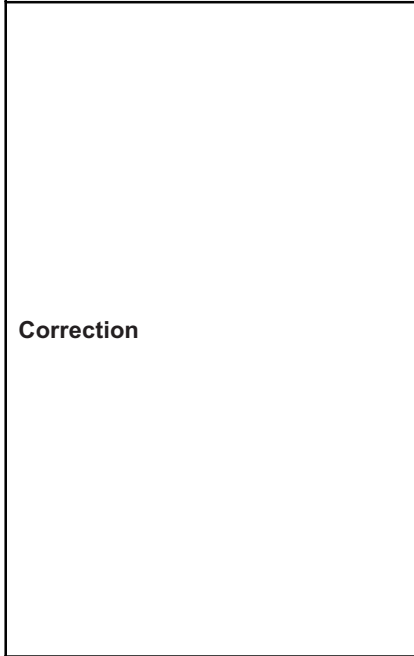

5615611

Inspect for a leak and repair as necessary.

## Service Procedure



5703542



5613597


Inspect and repair water leak as necessary.

If you encounter a vehicle with the above conditions, you must also include an inspection of the connectors in the water path. Inspect both the A and B-pillar interior trim and in-line connectors under the instrument panel (IP) for signs of a water leak at front roof and the rear cargo interior trim, headliner, and spare tire area for signs of a water leak at rear roof.

Once the water leak is found, repair any damage that may have been done due to the water leak.

Once the damage is repaired, apply seam sealer along the roof to body seam to correct the condition.

## Inspect and Clean Body-IP Inline Connectors and Seat Belt Retractor Pretensioners

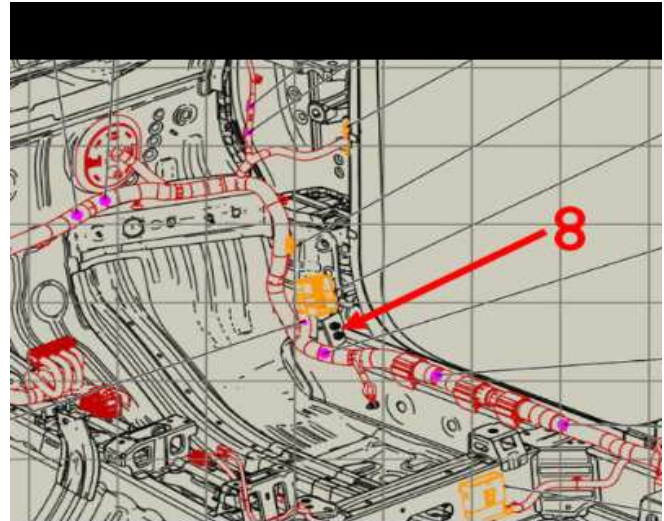

5752326




5703541

**(#8) — X204 Instrument Panel Harness to Body Harness, 76-way connector right side**

**(#6) — X202 Instrument Panel Harness to Body Harness, 2-way connector left side**

**(#7) — X200 Instrument Panel Harness to Body Harness, 76-way connector left side**

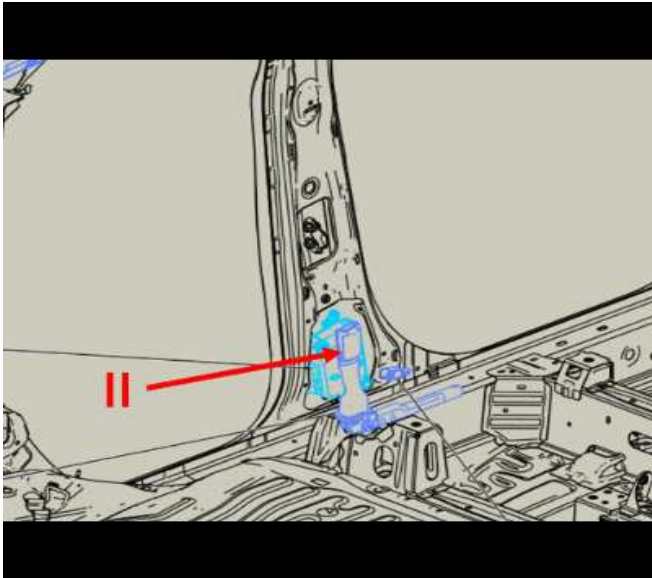

5752327

**(#11) — F112D Seat Belt Retractor Pretensioner  
- Driver****(#4) — F112P Seat Belt Retractor Pretensioner  
– Passenger (not shown)**

Clean the water inside of the connector and apply NYOGEL on terminals for waterproofing.

1. With vehicle off, disconnect the battery.
2. To access the connectors, remove the left and right garnish trim. Refer to *Front Side Door Sill Garnish Molding Replacement* and *Center Pillar Lower Trim Panel Replacement* in SI.
3. Inspect the connectors for any moisture. If needed, clean using a clean nylon bristle brush and dry connector using compressed air.
4. Preparing NYOGEL 760G (electrical grease) and flatting tool, apply on IP harness inline connector surface. Make sure all terminal pins are covered enough by grease.
5. Reattach the connectors. Make sure the 2nd locking tab is closed.
6. Reinstall the garnish trim. Refer to *Front Side Door Sill Garnish Molding Replacement* and *Center Pillar Lower Trim Panel Replacement* in SI.

## Parts Information

Causal Part	Description	Part Number	Qty	Contact Information
N/A	NYOGEL 760G (electrical grease)	760G	1	TAI Lubricants, Inc. PO Box 1579 Hockessin, DE 19707 Tel: 1-302-326-0200 Fax: 1-302-326-0400 sales@TAI- Lubricants.com or visit www.tai-lubricants.com

Causal Part	Description	Part Number	Qty
N/A	Kent® High-Tech Seam Sealer Clear	P10200	1
Or			
N/A	Würth Euroseal Gel Clear	18920104 (892.0104 in Canada)	1

## Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
1481498*	Inspect/Clean Body-IP Inline Connectors, Seat Belt Retractor Pretensioners and Body Joint Resealing	1.2 hrs
<p>*This is a unique Labor Operation for bulletin use only. For consequential damage, use the labor operation associated with this bulletin. All parts and labor associated should be claimed on the same transaction, using OLH as necessary to cover the labor for repair/replacement of the subsequently damaged part(s). Refer to Service Bulletin #18-NA-146 for additional information.</p>		

<b>Version</b>	4
<b>Modified</b>	<p>Released June 03, 2020</p> <p>January 20, 2021 – Added the 2021 Model Year to Encore GX and updated information to inspect the entire roof, not just the rear.</p> <p>March 05, 2021 – Added the Inspect and Clean Body-IP Inline Connectors and Seat Belt Retractor Pretensioners section and updated the Parts and Warranty Information.</p> <p>May 20, 2021 – Updated the Subject and Condition section to include DTCs and other possible conditions.</p>

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY  
TECHNICIAN  
CERTIFICATION