



Bulletin No.: PIP5762A  
Published date: 06/3/2021

## Preliminary Information

### PIP5762A 3.0L LM2 Diesel With Possible Oil Consumption, With or Without DTC P06DD

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 1500	2020	All	All	LM2	All
GMC	Sierra 1500	2020	All	All	LM2	All

Involved Region or Country	North America
Condition	A customer may have a concern with oil consumption. The technician may find DTC P06DD set.
Cause	Camshaft housing (cover) may have a baffle plate weld that is not adequate.

#### Correction:

Inspect the cam cover label for Julian dates and daily progressive number starting from 39H219 249 1 0098 through 39H219 253 1 0037.





If the serial number is NOT in the range above this PI does not apply. Refer to [PIP5751](#) and SI for appropriate diagnostics.

If the serial number is from 39H219 249 1 0098 through 39H219 253 1 0037 and the customer's concern is oil consumption:

- 1) Replace the camshaft housing cover.
- 2) Replace the #2 glow plug.

### Parts Information

Use the vehicle identification number (VIN), SI, and the GM Electronic Parts Catalog to determine the correct part to order.

### Warranty Information

For vehicles repaired under the Powertrain coverage, use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4087688	Replace camshaft housing and glow plug	8.1 Hrs.
*This is a unique Labor Operation for Bulletin use only.		

### Version History

Version	2
Modified	12/10/2020 Created on. 06/03/2021 - Updated to remove part numbers.



GENERAL MOTORS

© 2021 General Motors. All Rights Reserved.