



Bulletin No.: PIP5776E

Published date: N/A

## Preliminary Information

### PIP5776E Misfire Due To Collapsed Lifter

#### Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Cadillac	Escalade	2021	September 1, 2020	March 31, 2021	6.2 L87	All
Chevrolet	Silverado 1500	2020 - 2021	September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All
Chevrolet	Suburban	2021	September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All
Chevrolet	Tahoe	2021	September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All
GMC	Sierra 1500	2020 - 2021	September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All
GMC	Yukon	2021	September 1, 2020	March 31, 2021	5.3 L84 6.2 L87	All

Involved Region or Country	<b>North America, Middle East, Australia and New Zealand</b>
Condition	The vehicle may come in with a P0300 - P0308 set with a bent push rod that leads to a Collapsed lifter or a lifter that come apart.
Cause	Internal lifter concern.

#### Correction:

If service information leads to a collapsed lifter and/or lifter has come apart including a bent pushrod it will be necessary to follow the replacement guideline below.

- If vehicle has under 8000 miles (12,875km) and is within the breakpoint window it will be necessary to replace all lifters and guides on both banks.
- If vehicle has over 8000 miles (12,875km) and is within the breakpoint window it will be necessary to replace the lifters and guides on the effected bank only not both.

**Breakpoint for the models effected September 1, 2020 to March 31, 2021**

When replacing the lifter and guide please indicated which lifter has failed by marking its location on the guide for inspection (please do not cover the date code). The parts will be requested back.

**Note:** It is not necessary to replace the oil control solenoid for this failure mode.

If the vehicle does not fall into the breakpoint window, please follow the latest version of [19-NA-218](#).

#### Warranty Information

For this repair use the published labor time as called out in SI Labor Time Guide.

#### Version History

Version	6
Modified	01/20/2021 - Created on.

02/23/2021 - Added the Middle East  
03/04/2021 - Updated to clarify models.  
04/23/2021 - Update to change the correction statement  
05/17/2021 - Update to add breakpoint and remove 2019 MY  
06/18/2021 - Updated to add repair information



© 2021 General Motors. All Rights Reserved.