



# TECHNICAL SERVICE BULLETIN

## Hazard Lamps Flashing One Time Intermittently When The Hazard Lamps Are Turned Off

**21-2456**

23 December  
2021

### Model:

<b>Ford</b> 2021 Bronco
----------------------------

**Issue:** Some 2021 Bronco vehicles equipped with exterior zone lighting may experience the hazard lamps flashing one time intermittently when the hazard lamps are turned off. This condition is due to the body control module (BCM) software. This condition occurs when zone lighting is activated then deactivated while the engine is off, or during an engine auto-start-stop event. To correct this condition, follow the Service Procedure to reprogram the BCM.

**Action:** Follow the Service Procedure to correct the condition on vehicles that meet all of the following criteria:

- 2021 Bronco
- Equipped with zone lighting
- Hazard lamps flashing one time intermittently when the hazard lamps are turned off

**Warranty Status:** Eligible under provisions of New Vehicle Limited Warranty (NVLW)/Service Part Warranty (SPW)/Special Service Part (SSP)/Extended Service Plan (ESP) coverage. Limits/policies/prior approvals are not altered by a TSB. NVLW/SPW/SSP/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

### Labor Times

Description	Operation No.	Time
2021 Bronco: Reprogram The BCM Includes Time To Calibrate The Tire Pressure Monitoring System Sensors (Do Not Use With Any Other Labor Operations)	212456A	0.3 Hrs.

### Repair/Claim Coding

Causal Part:	RECAL
Condition Code:	01

### Service Procedure

1. Reprogram the BCM using the latest level of the Ford Diagnosis and Repair System (FDRS) scan tool.
2. Perform the tire pressure monitoring system (TPMS) sensor location calibration. Refer to Workshop Manual (WSM), Section 204-04.

© 2021 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.