



Bulletin No.: PIP5833

Published date: N/A

Preliminary Information

PIP5833 Diesel Exhaust Fluid Controller Update

Models

Brand:	Model:	Model Years:	VIN:		Engine:	Transmissions:
			from	to		
Chevrolet	Silverado 2500 HD	2020 - 2022	All	All	L5P	All

Involved Region or Country:	North America
Condition:	Some customers may comment the MIL is illuminated and/or a Service Reductant System or Service Emission System message is displayed, and DTCs P02C1, P21DD, P221C, P10D9, P10F3, P143C, P20B9, and/or P221E may be set.
Cause:	This may be caused by a software anomaly in the DEF controller.

Correction:

Update the DEF Controller using SPS programming.

If the the DEF controller has the latest anomaly installed, proceed with normal SI diagnostics.

This PI will be closed when bulletin [21-NA-006](#) has been updated.

Version History

Version	1
Modified	12/21/2021 - Created on.



GENERAL MOTORS

© 2022 General Motors. All Rights Reserved.