



Service Bulletin

Bulletin No.: 22-NA-176

Date: September, 2022

TECHNICAL

Subject: 8L45 8L90 No Movement After Valve Body Replacement

This bulletin replace PIP5741A. Please discard PIP5741A.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	from	to		
Cadillac	ATS	2016	2019				M5N,M5U
	CT4	2020	2023				M5N
	CT6	2016	2018				M5N,M5X
	CTS	2016	2019				M5N,M5U
	Escalade	2016	2023				M5U
Chevrolet	Camaro	2016	2022				M5T,M5U
	Corvette	2015	2019				M5U
	Express	2017	2022				M5U
	Silverado	2016	2018				M5U
	Silverado 1500	2019	2021				MQE
	Silverado 1500 - LTD (RPO J21, VIN Digit 5 = W/Y)	2022	2022				M5X, MQE
	Silverado 1500 - New (RPO J22, VIN Digit 5 = A/D)						
Tahoe	2015	2022				M5N	
GMC	Savana	2016	2022				M5U
	Sierra	2016	2018				M5U
	Sierra 1500	2019	2021				M5U
	Sierra 1500 - Limited (RPO J21, VIN Digit 5 = 8/9)	2022	2022				M5X, MQE
	GMC Sierra 1500 - New (RPO J22, VIN Digit 5 = H/U)						
	Yukon	2015	2022				M5U

Involved Region or Country	North America
Condition	Some technicians may comment on no movement after the valve body replacement.
Cause	This may be caused by a plug and retaining bolt missing on valve body.



6144951

Inspect for the plug (1) and retaining bolt (2) as noted in the graphic above.

Correction



5619627

If the plug and retaining bolt are missing, fill out the WPC part request form and send it to the WPC following the instructions below.

- ⇒ The plug and retaining bolt are packaged as a kit.
- ⇒ The kit part number is WPC 853 and can be obtained from the Warranty Parts Center (WPC) using the TSP Dealer Request Form

This form is located on:

Global Connect<Service Department<Service Forms Application<General Information tab<TSP Dealer Request Form.

Instructions for submitting are on the form.

Request WPC###.

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Service Procedure

Refer to *Control Valve Body Replacement* in the Service Manual.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
8463690	Control Valve Body Replacement	Use Published Labor Time

Version	1
Modified	Released September 01, 2022

