



Service Bulletin

Bulletin No.: 22-NA-184

Date: September, 2022

INFORMATION

Subject: Information on 8L45 8L90 Automatic Transmissions With No Movement After Valve Body Replacement

This bulletin replaces PIP5784. Please discard PIP5784.

Brand:	Model:	Model Year:		VIN:		Engine:	Transmission:
		from	to	From	to		
Cadillac	ATS Models	2016	2019				M5N M5T M5U
	CT4 Models	2020	2022				M5N
	CT6	2016	2018				M5N M5X
	CTS Models	2016	2019				M5N M5U
	Escalade Models	2015	2017				M5U
Chevrolet	Camaro	2016	2022				M5T M5U
	Colorado	2017	2022				M5T
	Corvette	2015	2019				M5U
	Express	2017	2022				M5U MQD
	Silverado	2015	2018				M5U M5X
	Silverado 1500 LD	2019	2019				MQE
	Silverado 1500 Mew Model	2019	2019				MQE
	Silverado 1500	2020	2022				MQE
	Suburban	2015	2017				M5U
GMC	Canyon	2017	2022				M5T
	Savana	2017	2022	M5U MQD			
	Sierra	2015	2018	M5U M5X			
	Sierra 1500 Limited	2019	2019	MQE			
	Sierra 1500 New Model	2019	2019	MQE			
	Sierra 1500	2020	2022	MQE			
	Yukon Denali	2015	2017	M5U			

Involved Region or Country	North America, Middle East
Condition	Technician's may find a no movement condition after replacement of the valve body on the 8L45 or 8L90 automatic transmission.
Cause	This may be due to the incorrect 1-2-7-8-R clutch fluid passage seal being installed or it is missing.
Correction	<p>Technician should remove the transmission valve body and inspect for the 1-2-7-8-R clutch fluid passage seal to be installed correctly.</p> <p>If the 1-2-7-8-R clutch fluid passage seal was installed during the valve body, then the technician will need to measure the length of the seal to make sure the correct seal was installed.</p> <p>The 8L45 seal part number is 24262438 and the seal has no ID notches. This seal is 33.5 MM (1,32 in) tall.</p> <p>The 8L90 seal part number is 24259218 and the seal has 5 ID notches. This seal is 23.1 MM (0.91 in) tall.</p>

Version	1
Modified	Released September 07, 2022

