



Service Bulletin

Bulletin No.: 22-NA-060

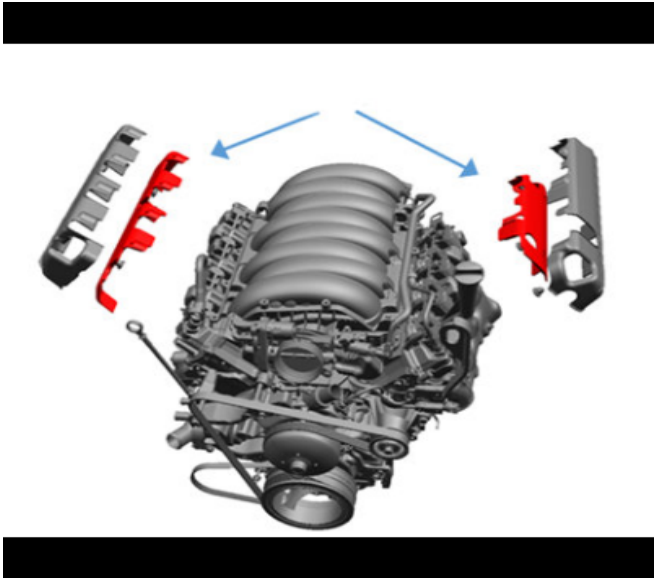
Date: September, 2022

INFORMATION

Subject: Information on Possible Tick or Rattle Noise Concern from Left and/or Right Side Rocker Cover

Brand:	Model:	Model Year:		Breakpoint Date:		Engine:	Transmission:
		from	to	from	to		
Cadillac	Escalade Models	2022	2022	March 20, 2022	April 10, 2022	5.3L (L84), 6.2L (L87)	
Chevrolet	Silverado 1500 - LTD (RPO J21, VIN Digit 12 = 4 or less)						
	Silverado 1500 - New (RPO J22, VIN Digit 12 = 5 or greater)						
	Silverado 2500HD/ 3500HD						
	Suburban						
	Tahoe						
GMC	Sierra 1500 - Limited (RPO J21, VIN Digit 12 = 4 or less)						
	Sierra 1500 - Limited (RPO J22, VIN Digit 12 = 5 or greater)						
	Sierra 2500HD/ 3500HD						
	Yukon Models						

Involved Region or Country	North America
Condition	Some customers may comment that they hear a tick or rattle type noise coming from the engine compartment – This noise may be noticeable on the top of the engine near the left or right-side rocker cover area.

<p>Cause</p>	<p>This condition may be caused by the left or right side rocker cover insulator.</p> <ul style="list-style-type: none"> – For a short period of time the insulator was manufactured without the fiberglass insulation (as indicated in the graphic below) that is used to reduce the normal engine valvetrain noise. This was due to an unavoidable supply shortage issue. Without this fiberglass insulation an increase in valvetrain noise on that bank may be noticeable.  <p style="text-align: right;">6018737</p>
<p>Correction</p>	<p>If you encounter a vehicle with this condition and the noise is unacceptable to the customer, you can install a service cover which has the insulation attached to the insulator to help reduce the valvetrain noise.</p>

Service Procedure

Refer to *Valve Rocker Arm Cover Insulator Replacement - Left Side* in the Service Manual and/or *Valve Rocker Arm Cover Insulator Replacement - Right Side* in the Service Manual.

Parts Information

Causal Part	RPO	Description	Part Number	Qty
X	5.3L RPO (L84) 6.2L RPO (L87)	INSULATOR, VLV RKR ARM CVR	12674122	1
X	5.3L RPO (L84) 6.2L RPO (L87)	INSULATOR, VLV RKR ARM CVR RIGHT	12703336	1
X	6.6L RPO (L8T)	INSULATOR, VLV RKR ARM CVR LEFT	12703339	1
X	6.6L RPO (L8T)	INSULATOR, VLV RKR ARM CVR RIGHT	12703340	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4060740	Valve Rocker Arm Cover Insulator Replacement – Right Side	Use the Published Labor Operations Time
4060750	Valve Rocker Arm Cover Insulator Replacement – Left Side	

Version	1
Modified	Released September 16, 2022

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY
TECHNICIAN
CERTIFICATION