

## **Service Bulletin**

Bulletin No.: 22-NA-196

Date: October, 2022

## **INFORMATION**

Subject: Information on Low Engine RPM with No Throttle Response

Brand:	Model:	Model Year:		VIN:		Engine	Transmission:
		from	to	from	to	Engine:	Transmission.
Chevrolet	Silverado LTD (RPO J21, VIN Digit 5 = W/Y)	2022	2022			LM2	
GMC	Sierra Limited (RPO J21, VIN Digit 5 = 8/9)						

Involved Region or Country	North America			
Condition	Some customers may comment that when starting the engine from the RUN power mode the engine will idle at low RPMs (400 RPMs) and there will be no throttle response.			
Cause	This condition may be caused by the wrong generator installed.			
Information	Check IVH to verify if the generator has been replaced:  Generator part number 13539731 is released for 2022 LM2 with J21 engineering model year  Generator part number 13540929 is released for 2022 LM2 with J22 engineering model year  If it was found that the J1 vehicle had the incorrect J2 generator installed, replace the generator with the part number indicated above, per engineering model year.			

Important: Service agents must comply with all International, Federal, State, Provincial, and/or Local laws applicable to the activities it performs under this bulletin, including but not limited to handling, deploying, preparing, classifying, packaging, marking, labeling, and shipping dangerous goods. In the event of a conflict between the procedures set forth in this bulletin and the laws that apply to your dealership, you must follow those applicable laws.

Version	1			
Modified	Released October 04, 2022			

