



TECHNICAL SERVICE BULLETIN

Flutter/Rattle Noise In The Hood While Driving Above 80 MPH (129 KM/H)

22-2382

28 October
2022

Model:

Ford 2022 Maverick	Built on or before 3-Aug-2022
------------------------------	-------------------------------

Issue: Some 2022 Maverick vehicles built on or before 3-Aug-2022 may exhibit a flutter or rattle noise in the hood while driving above 80 mph (129 km/h). This may be due to a gap between the hood and the weather strip located in the cowl panel grille. To correct this condition, follow the Service Procedure to diagnose and install a foam tape in the cowl panel grille.

Action: Follow the Service Procedure to correct the condition on vehicles that meet all of the following criteria:

- 2022 Maverick
- Built on or before 3-Aug-2022
- Flutter/rattle noise in the hood coming from the right front section of the cowl panel grille while driving above 80 mph (129 km/h)

Parts

Service Part Number	Quantity	Description
P1PZ-2021702-A	1	Foam Tape

Warranty Status: Eligible under provisions of New Vehicle Limited Warranty (NVLW)/Service Part Warranty (SPW)/Special Service Part (SSP)/Extended Service Plan (ESP) coverage. Limits/policies/prior approvals are not altered by a TSB. NVLW/SPW/SSP/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
2022 Maverick: Install Foam Block Following The Service Procedure (Do Not Use With Any Other Labor Operations)	222382A	0.3 Hrs.


Repair/Claim Coding

Causal Part:	16612
Condition Code:	07

Service Procedure

1. Install a foam block tape in the right center section of the cowl panel grill. (Figure 1)

Figure 1

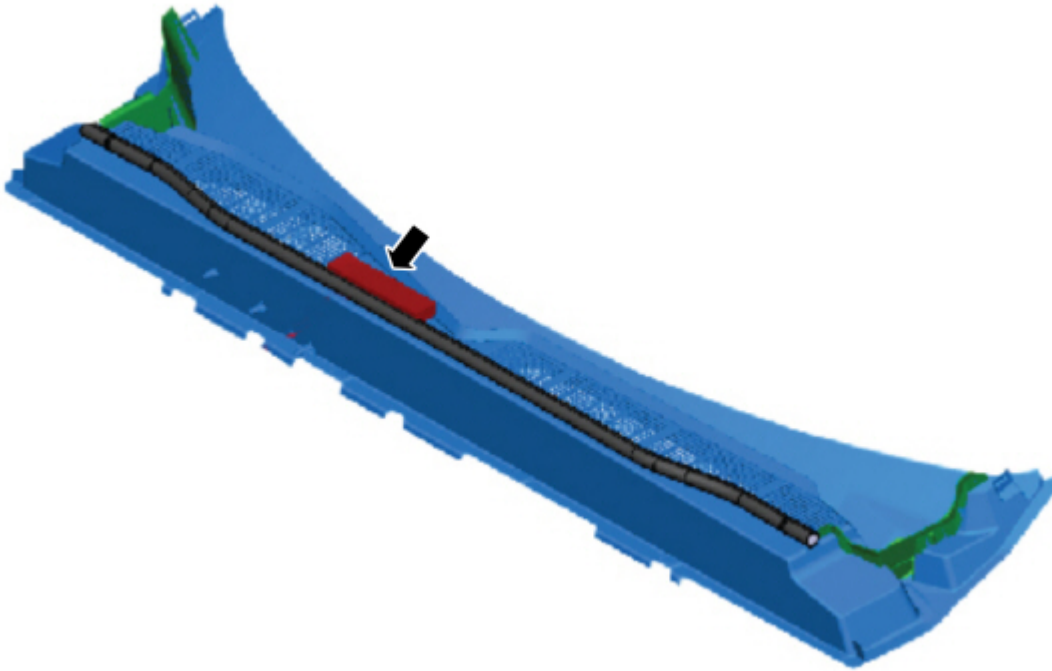

E396422

© 2022 Ford Motor Company
All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.