



TECHNICAL SERVICE BULLETIN

Inoperative Cabin Preconditioning

23-2169

31 May 2023

Model:

Ford 2022-2023 F-150

Issue: Some 2022-2023 F-150 Lightning vehicles may exhibit an inoperative cabin preconditioning event. This may be due to the current software level of several modules in the vehicle. To correct this condition, follow the Service Procedure to update the applicable modules to their latest software level.

Action: Follow the Service Procedure to correct the conditions on vehicles that meet the following criteria:

- 2022-2023 F-150 Lightning
- Inoperative preconditioning feature

Warranty Status: Eligible under provisions of New Vehicle Limited Warranty (NVLW)/Service Part Warranty (SPW)/Special Service Part (SSP)/Extended Service Plan (ESP) coverage. Limits/policies/prior approvals are not altered by a TSB. NVLW/SPW/SSP/ESP coverage limits are determined by the identified causal part and verified using the OASIS part coverage tool.

Labor Times

Description	Operation No.	Time
2022-2023 F-150 Lightning: Reprogram The Appropriate Modules As Required By The Software Update And Service Procedure (Do Not Use With Any Other Labor Operations)	MT232169	Actual Time

Repair/Claim Coding

Causal Part:	RECAL
Condition Code:	04

Service Procedure

1. Reprogram the powertrain control module (PCM) using the latest software level of the Ford Diagnosis and Repair System (FDRS). Follow all on-screen instructions carefully to complete all coordinated module software updates.
2. Check for available software updates on the following modules and update as required:
 - Anti-lock brake system (ABS) module
 - Battery energy control module (BECM)
 - Secondary on-board diagnostic control module (SOBDM)
 - Secondary on-board diagnostic control module B (SOBDMB)
 - Secondary on-board diagnostic control module C (SOBDM-C)
 - If the vehicle is equipped with dual chargers, generic function module 2 (GFM2)

© 2023 Ford Motor Company

All rights reserved.

NOTE: The information in Technical Service Bulletins is intended for use by trained, professional technicians with the knowledge, tools, and equipment to do the job properly and safely. It informs these technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by "do-it-yourselfers". Do not assume that a condition described affects your car or truck. Contact a Ford or Lincoln dealership to determine whether the Bulletin applies to your vehicle. Warranty Policy and Extended Service Plan documentation determine Warranty and/or Extended Service Plan coverage unless stated otherwise in the TSB article. The information in this Technical Service Bulletin (TSB) was current at the time of printing. Ford Motor Company reserves the right to supersede this information with updates. The most recent information is available through Ford Motor Company's on-line technical resources.

