



SERVICE BULLETIN

Classification:

FE07-002

Reference:

NTB07-025

Date:

April 4, 2007

2006 – 2007 MURANO; DIFFICULT TO REFUEL VEHICLE

APPLIED VEHICLES: 2006 - 2007 Murano (Z50)**APPLIED VINs:**

2006 All VINs

2007 built before: JN8AZ08T(*)7W513474 or
JN8AZ08W(*)7W637519**APPLIED DATE:**

Vehicles built before: January 16, 2007

IF YOU CONFIRM

It is difficult to restart the fuel filling nozzle if it is shut off during fueling.

ACTION

Replace the fuel tank with the one listed in Parts Information.

- Refer to the Electronic Service Manual (ESM) section FL for fuel tank removal and installation procedure.
- Make sure to use new o-rings (packing) for the fuel pump and sub fuel level sensor.

WARNING: Be sure to read "General Precautions" in the FL section of the Service Manual when working on the fuel system.

PARTS INFORMATION

DESCRIPTION	PART #	QUANTITY
Fuel Pump Packing (O-ring)	17342-CC20A	2
Fuel Tank	17202-CC20B	1

CLAIMS INFORMATION

Submit a Primary Part (PP) type line claim using the following claims coding:

DESCRIPTION	PFP	OP CODE	SYM	DIA	FRT
RPL Fuel Tank & Pump Packing	(1)	FB10AA	ZE	32	(2)

(1) Reference the Parts Information Table and use the applicable Fuel Tank P/N as the PFP.

(2) Reference the current Nissan Warranty Flat Rate manual and use the indicated FRT.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.