



SERVICE BULLETIN

Classification: BT07-030	Reference: NTB07-063	Date: September 6, 2007
-----------------------------	-------------------------	----------------------------

PATHFINDER, FRONTIER, XTERRA; SQUEAK NOISE FROM FRONT OF VEHICLE WHILE DRIVING

APPLIED VEHICLES: 2007 - 2008 Pathfinder (R51)
2007 - 2008 Frontier (D40)
2007 - 2008 Xterra (N50)

IF YOU CONFIRM

A Squeak noise is heard from front of vehicle while driving speed bumps or rough roads.

and

The noise is coming from the hood bump stop.

and

The noise is **not** coming from the fuel pump.

ACTION

Check the adjustment of the hood center bump stop height.

- SPECIFICATION: **approximately** 19 mm (**0.74 in**).

NOTE: If the height is below 19 mm a squeak noise will be heard.

Test drive the vehicle to make sure the noise has been eliminated.

CLAIMS INFORMATION

Submit a Primary Operation (PO) line claim using the following claims coding:

DESCRIPTION	OP CODE	SYM	DIA	FRT
Adjust Hood (1)	WH10AA	ZL	41	(2)

(1) Adjustment coverage applies for up to 12 months/12,000 miles from vehicle in service date.

(2) Reference the current Nissan Warranty Flat Rate Manual and use the indicated FRT.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.