WORK DESCRIPTION FOR FIELD MEASURE

Code: 21P5891117 **Version: 2.0**

Update Digital Operator's Manual and supply printed operator's manual, replace if necessary Model 213.0 with code 800

i The codes correspond to:

- 800 MODIFICATION YEAR 2019/1.
- 531 COMAND APS NTG5/NTG5.5.

Work procedure A:

Update Digital Operator's Manual, with parts scope

Page 2/3

Work procedure B:

Supply printed operator's manual as aftermarket measure; replace if necessary, with parts scope Page 3/3

Operation text and flat rate

Page 3/3

Code: 21P5891117 **Version: 2.0**

Work	procedure	Α

i Update Digital Operator's Manual.

• Ensure use of **XENTRY Diagnosis version** BD/DVD (**09/2020**) or higher.

- Before starting the work procedure, install all the **add-ons that are updated daily** in **XENTRY Diagnosis**.
- Make sure to follow the operation steps exactly as described in XENTRY Diagnosis.
- Use a battery charger to ensure sufficient power supply of the vehicle **on-board electrical system battery** (greater than 12.5 V).
- If XENTRY Diagnosis is already connected to the vehicle, start with **operation step 2**.

 i If two or more software updates or SCN codings are performed during one workshop visit, operation items 02-4762 and 02-5058 may be invoiced **once only for each workshop order**.
- 1. Connect XENTRY Diagnosis.
- 2. <u>Up</u>date COMAND Online control unit software.

To do this, select menu item "Quick test view – COMAND Online - Adaptations – Commissioning of control unit – Commissioning of the already installed control unit".

1 Then follow the user guidance in XENTRY Diagnosis.

- 3. Disconnect XENTRY Diagnosis.
- 4. Carry out work procedure B.

Parts scope - Digital Operator's Manual

Quantity	Designation	Part no.
1	Digital Operator's Manual	*

^{*} The Digital Operator's Manuals relating to the vehicle identification number and equipment variant must be procured via the parts process in XENTRY Portal.

Code: 21P5891117 **Version: 2.0**

Work procedure B

Supply printed operator's manual as an aftermarket measure, replace if necessary.

1. Check whether the printed operator's manual is in the vehicle document wallet and whether it is the correct version, supply if necessary.

If a printed operator's manual is **not present**, the printed operator's manual must be placed in the vehicle document wallet as an aftermarket measure.

Li If there is a printed operator's manual, compare it with the parts table and replace if necessary.

Parts scope - Printed operator's manual

Quantity	Part no.	Designation	Language	Code
As required (1)*	A 213 584 62 13	OPERATOR'S MANUAL COMAND US ENGL USA CAN A-2020	English USA	800 + 531 + 12B

^{*} The operator's manuals must be procured via the parts process in XENTRY Portal.

Operation text and flat rate

Operation no.	Operation text	Flat rate	Accounting no./ damage code	
02-9445	Update Digital Operator's Manual (XENTRY Diagnosis connected)	0.1 h	58 911 17	
02-9471*	Check operator's manual, supply if necessary	0.1 h	58 911 17	
02-4762**	Connect/disconnect diagnostic system (XENTRY Diagnosis)	0.1 h	58 911 17	
02-5058**	Connect/disconnect starter battery charger (XENTRY Diagnosis connected)	0.1 h	58 911 17	

^{*} The operation item includes 3 operations to check the operator's manual and supply if necessary. Therefore the operation item is to be used with the appropriate frequency according to the vehicle equipment! For 1 to 3 operator's manuals the operation item is to be used 1 time. For 4 to 6 operator's manuals the operation item is to be used 2 times. For 7 to 9 operator's manuals the operation item is to be used 3 times.

Mercedes-Benz Global Service & Parts

^{**} The operation item may only be used invoiced once in each workshop order!