WORK DESCRIPTION FOR FIELD MEASURE

Code: 22P9790021 **Version: 2.1**

Check seam seal in left front wheel arch, rework if necessary

Model 295

Modification note: Part number Seam seal adjusted in parts table

Check/test procedure A

- 1. Remove left front fender liner rear section.
 - i For basic data, see AR88.10-P-1301EQE.
- 2. Check seam seal in left front wheel arch.
 - I Seam seal must be full-length (without interruptions).

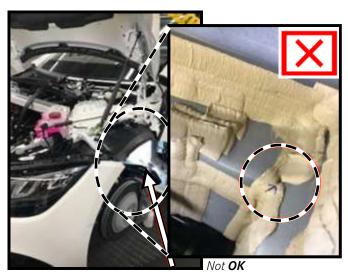


Figure 1

- a. Seam seal in left front wheel arch not OK: Perform check/test procedure B.
- b. Seam seal in left front wheel arch OK: End measure.

Check/test procedure B

- 1. Check whether moisture is present in left front floor covering in crossmember area of firewall and in adjacent footwell.
 - **1** Expose left front floor covering until area is accessible.
 - **1.1.** Slide left front seat toward rear.
 - 1.2. Remove left front door sill.
 - i For basic data, see AR68.30-P-4100EQS.

Code: 22P9790021 **Version: 2.1**

- **1.3.** Remove lower trim for left instrument panel.
 - I For basic data, see AR68.10-P-1501EQS.
- **1.4.** Lift left front floor covering and check for moisture.
 - i Floor covering does not have to be fully removed.



- a. Left front floor covering shows **no** moisture: Perform work procedure A.
- **b.** Left front floor covering **shows** moisture: Perform **work procedure A and B**.

Work procedure A

- 1. Rework seam seal in left front wheel arch.
 - I Seam seal must be full-length (without interruptions).
- 2. Assemble in reverse order.

Work procedure B

- 1. Eliminate moisture in driver footwell.
- **2.** Assemble in reverse order

Parts

Quantity	Designation	Part no.
As required	Seam seal	A 005 989 63 20 <mark>11</mark> 9678
(1)*		

^{*} The container must be used for approx. 10 vehicles!

I Small parts such as screws/bolts, lock nuts, sealing rings, cable ties, fluids, sealant, etc. are not listed in the parts list. The required small parts are taken into account in the budgeting.

Code: 22P9790021 **Version: 2.1**

Operation text and flat rate

Operation no.	Operation text	Flat rate	Accounting no./ damage code
12-1512	Check seam seal in left front wheel arch Includes : Remove/install left front fender liner rear section	0.6 h	97 900 21
12-1513	Check left front floor covering (after check/test procedure A) Includes: Remove/install left front door sill; remove/install lower trim for left instrument panel; expose left front floor covering	0.6 h	97 900 21
12-1514	Rework seam seal in left front wheel arch (after check)	0.1 h	97 900 21
12-1515	Eliminate moisture in driver footwell (after check)	Time prescribed by foreperson	97 900 21