WORK DESCRIPTION FOR FIELD MEASURE

Check seam seal in left front wheel arch, rework if necessary

Model 295

Check/test procedure A

- 1. Remove left front fender liner rear section.

 i For basic data, see AR88.10-P-1301EQE.
- 2. Check seam seal in left front wheel arch.
 - i Seam seal must be full-length (without interruptions).

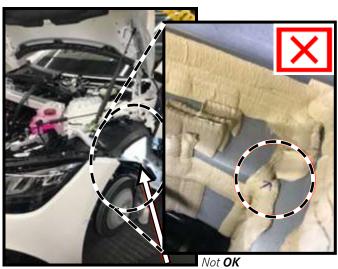


Figure 1

- a. Seam seal in left front wheel arch not OK: Perform check/test procedure B.
- b. Seam seal in left front wheel arch OK: End measure.

Check/test procedure B

- 1. Check whether moisture is present in left front floor covering in crossmember area of firewall and in adjacent footwell.
 - **i** Expose left front floor covering until area is accessible.
 - 1.1. Slide left front seat toward rear.
 - **1.2.** Remove left front door sill.
 - i For basic data, see AR68.30-P-4100EQS.
 - 1.3. Remove lower trim for left instrument panel.
 - For basic data, see AR68.10-P-1501EQS.

1.4. Lift left front floor covering and check for moisture.

i Floor covering does not have to be fully removed.



- a. Left front floor covering shows *no* moisture: Perform work procedure A.
- b. Left front floor covering *shows* moisture: Perform work procedure A and B.

Work procedure A

- Rework seam seal in left front wheel arch.
 Seam seal must be full-length (without interruptions).
- 2. Assemble in reverse order.

Work procedure B

- 1. Eliminate moisture in driver footwell.
- 2. Assemble in reverse order

Parts

| Quantity | Designation | Part no. |
|------------------|-------------|----------------------|
| As required (1)* | Seam seal | A 005 989 63 20 9678 |

^{*} The container must be used for approx. 10 vehicles!

in the parts list. The required small parts are taken into account in the budgeting.

Operation text and flat rate

| Operation no. | Operation text | Flat rate | Accounting no./ damage code |
|---------------|--|-------------------------------|-----------------------------|
| 12-1512 | Check seam seal in left front wheel arch Includes : Remove/install left front fender liner rear section | 0.6 h | 97 900 21 |
| 12-1513 | Check left front floor covering (after check/test procedure A) Includes: Remove/install left front door sill; remove/install lower trim for left instrument panel; expose left front floor covering | 0.6 h | 97 900 21 |
| 12-1514 | Rework seam seal in left front wheel arch (after check) | 0.1 h | 97 900 21 |
| 12-1515 | Eliminate moisture in driver footwell (after check) | Time prescribed by foreperson | 97 900 21 |