
	GROUP <b>Body</b>	MODEL <b>2011-2013 Optima (TF &amp; QF) 2011-2015MY Sorento (XMa)</b>
	NUMBER <b>PS235 (Rev 1, 06/25/2014)</b>	DATE <b>January 2013</b>




TECHNICAL OPERATIONS

**SUBJECT:**      **HORN ANSWER BACK OR PARKING LAMPS INOP  
WHEN LOCKING DOORS WITH RKE/SMK FOB**

When addressing a customer complaint related to an inoperative parking light confirmation flash, and/or audible answer back when locking the vehicle with the RKE/SMK fob, ensure each door lock position switch (viewable in **BCM > Current Data**) is displaying the appropriate status and the pad-lid switch (hood switch depressor) is in place on the hood. Refer to the photo and screenshot below for additional information.

- Check to make sure the pad-lid switch (hood switch depressor) is in place on the hood (A).

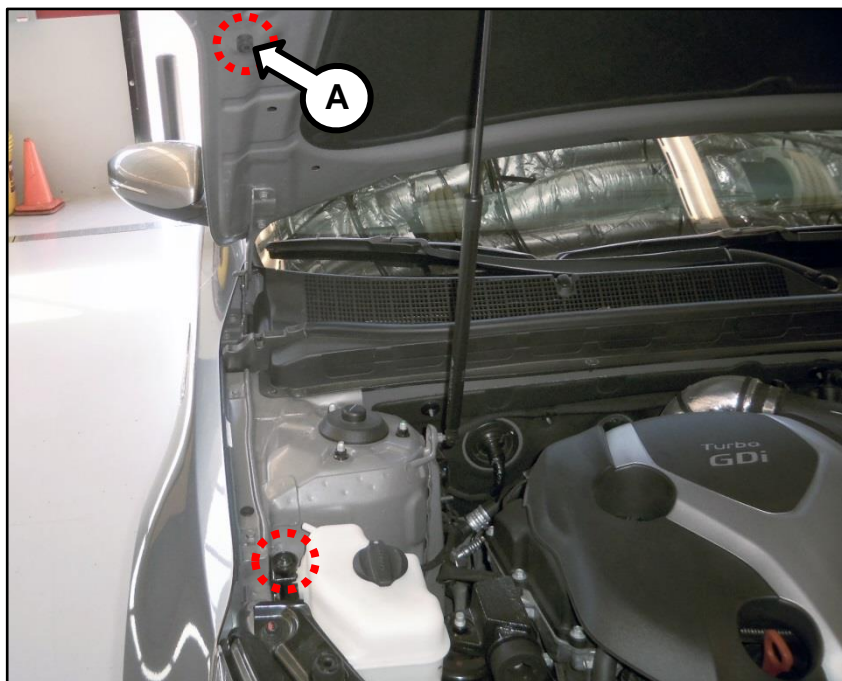

- Use GDS to Access **BCM > Current Data** and check for the status of the **Hood Switch** and **Door Actuator Position Switches**.

