


SB-10052333-8837

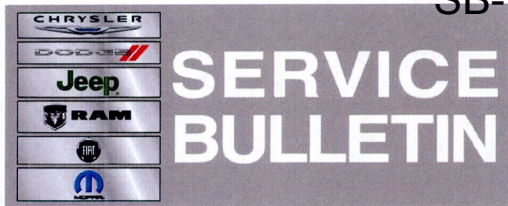

**NUMBER:** 18-020-13

**GROUP:** Vehicle Performance

**DATE:** May 02, 2013

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of Chrysler Group LLC.

**HELP USING THE wiTECH DIAGNOSTIC APPLICATION FOR FLASHING AN ECU IS AVAILABLE BY SELECTING "HELP" THEN "HELP CONTENTS" AT THE TOP OF THE wiTECH DIAGNOSTIC APPLICATION WINDOW.**

**THE wiTECH SOFTWARE LEVEL MUST BE AT RELEASE 13.03 OR HIGHER TO PERFORM THIS PROCEDURE.**

**SUBJECT:**

Flash: Erroneous P0573- Brake Switch 1 Stuck Off

**OVERVIEW:**

This bulletin involves selectively erasing and reprogramming the Powertrain Control Module (PCM) with new software to eliminate the potential of setting this erroneous Diagnostic Trouble Code.

**MODELS:**

2012	(LX)	300
2012	(LD)	Charger

**NOTE: This bulletin applies to vehicles equipped with a 6.4L engine (sales code ESG), 50 state emissions (sales code NAS) and a NAG1 automatic transmission (sales code DGJ) built before April 29, 2012 (MDH 0428XX).**

**SYMPTOM/CONDITION:**

Technician may find that the following erroneous Diagnostic Trouble Code has been set:

- P0573 - Brake Switch 1 Stuck Off

**DIAGNOSIS:**

Using a Scan Tool (wiTECH) with the appropriate Diagnostic Procedures available in TechCONNECT, verify all engine systems are functioning as designed. If DTC's other than the one listed above are present record them on the repair order and repair as necessary before proceeding further with this bulletin.

If the technician finds the listed DTC, perform the Repair Procedure.

**PARTS REQUIRED:**

Qty.	Part No.	Description
1	04275086AB	Label, Authorized Modification

**REPAIR PROCEDURE:**

**NOTE: Install a battery charger to ensure battery voltage does not drop below 13.2 volts. Do not allow the charging voltage to climb above 13.5 volts during the flash process.**

**NOTE: If this flash process is interrupted/aborted, the flash should be restarted.**

1. Reprogram the PCM with the latest software. Follow the detailed service procedures available in DealerCONNECT/TechCONNECT, Refer To Group 8 - Electrical > Electronic Control Modules - Service Information > Module - Powertrain Control > Standard Procedures > PCM/ECM Programming.
2. **After PCM reprogramming, the following must be performed:**clear any DTC's that may have been set in other modules due to reprogramming. The wiTECH application will automatically present all DTCs after the flash and allow the tech to clear them.
3. Type the necessary information on the "Authorized Modification Label" and attach it near the VECI label.

**POLICY:**

Reimbursable within the provisions of the warranty.

**TIME ALLOWANCE:**

Labor Operation No:	Description	Amount
18-19-06-U7	Module, Powertrain Control (PCM) Reprogram (1 - Semi-Skilled)	0.2 Hrs.

**FAILURE CODE:**

FM	Flash Module
----	--------------