

To All Lamborghini Dealers and Licensed Service Point

From Customer Service Department Subject Starter Ventilation Enhancement

Group 9.11.00 Date 15th/11/2013

Pages 6

Subject

Starter ventilation enhancement.

Model

All Lamborghini Aventador LP 700 Coupe and Roadster MY 12,13 and 14 from VIN CLA0091 to VIN ELA02238.

<u>Warning:</u> some vehicles included in this VIN range may not be involved, so check carefully on the Lamborghini WEB Portal (at the section named VIN Info) if the cars in your workshop or in your dealer stock are involved before performing any other operation.

Information to the field

As a result of continuous product monitoring, Automobili Lamborghini Spa has found that on some vehicles, the starter motor may not crank immediately upon start request.

Field solution

Replace lower starter motor screw without threadlocker, allowing for better temperature control.

Spare Parts

P/N	Description	Q
470198317	Screw without threadlocker	1

Warranty Claim data

The warranty reimbursement request for this rework action will be managed by the following standard Warranty Claim procedures.



Campaign Code: L83X-A.04.13

Campaign Description: Starter ventilation enhancement

Cost Code: 50

Component Code: CCA0413

Trouble Code: 220

Labour Code: CCA0413100


Labour Time: 0,4 h.

Remember to fill all data in the section "Service and Recall Campaign" in the Warranty booklet of the vehicle as shown below.

Service/Service Richlamo/Rückruf	Service/Service Richiamo/Rückruf
Service/Service Recall/Rappel Servicio Llamada a Talier	Service/Service Recall/Rappel Servicio Llamada a Taller
Numero/Nummer Number/Numéro Núméro	Numer of Num
Data/Datum/Date/Date/Fecha	Data/Datum/Date/Date/Fecha
Data riparazione/Reparaturdatum Repair Data/Data de réparation Rechair Data/Data de réparation Rechair reparación Indiana Indi	Bass calescione/Reparativisticum Receir Cala Dicta de régaration Fecha reparación
Eseguito dal Concessionaria / Auspellinit von der Vertragswerkstatt / Done by the Dealer Effectule par le concessionaria / Electuado por el Concesionario Firma / Uniterschrift / Signature / Signature / Firma	Esequito dal Concessionario / Ausgeführt von der Vertragswerkstatt / Done by the Dealer Effectué par le concessionarie / Efectuado por el Concessionario Firma / Unterschrift / Signature / Firma
Service/Service Richlamo/Rückruf Service/Service Recall/Rappel Servicio Liamada a Yaller	Service/Service Richamo/file/clrd Service/Service Recall/Rappel Servicio Llamada a faller
Numero/Nummer Number/Numero Numero	Numero Naminer Numero Naminero Naminero
Deta/Datum/Date/Date/Fecha	Data/Datum/Date/Date/Fecha



Identification

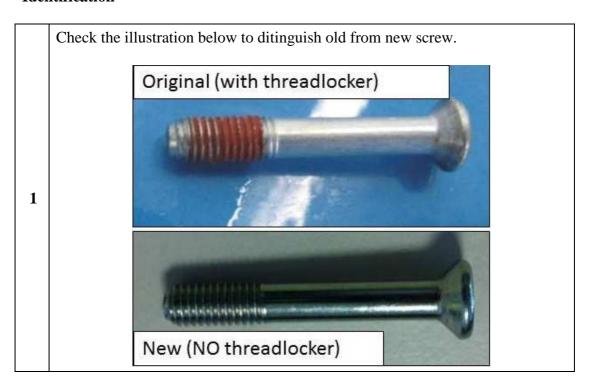






Description of required procedures

2 Place vehicle on suitable hoist and lift it properly to work safe from risks.

Identify the working Area and the lower screw to be replaced

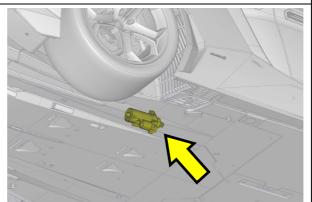

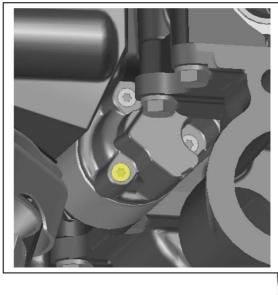

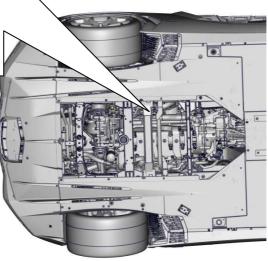







WARNING!

Operations to be performed at cold engine!

> Remove vehicle rear central bottom panel (082503)

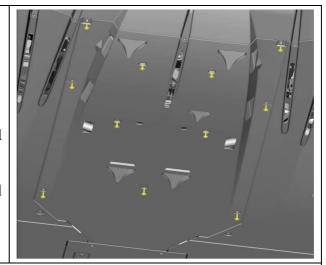

Detect the screw to be replaced: lower screw of starter motor.

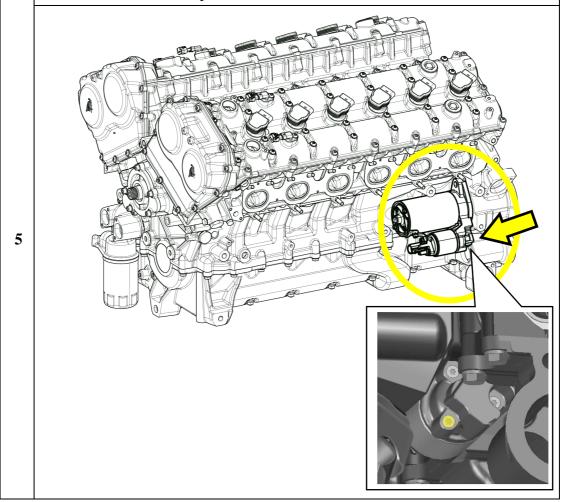



Unfasten and remove the screw.



Insert the new screw (p/n 470198317) and fasten without tightening it.

Unscrew completely the screw so that all the eventual threadlocker residues might come off from the tapped hole.

Clean eventually the screw from threadlocker remainings.

Reinstall and tighten completely the new screw.

Torque: 6 Nm



Reassembly

Fit vehicle rear central bottom panel (082505).

Please contact your Area Manager for any further information.

Yours sincerely

Customer Service.