

**November 28, 2014**

ATB 01104 (1411)

**MIL Comes On With DTC P2602****AFFECTED VEHICLES**

Year	Model	Trim	VIN Range
2014	Accord Plug-In	ALL	ALL

**SYMPTOM**

The MIL comes on with DTC P2602 (electric engine coolant pump circuit low voltage).

**POSSIBLE CAUSES**

Under certain conditions, the electric water pump may stick and set DTC P2602.

**CORRECTIVE ACTION**

Update the PGM-FI software.

**SOFTWARE INFORMATION**

NOTE: Unnecessary or incorrect repairs resulting from a failure to update the HDS or MVCI are not covered under warranty.

MVCI Control Module (CM) Update:

Application (FW) Version 3.01.40 **or later**

Database Update 20-Oct-2014 **or later**

HDS Software Version:

3.012.015 or later.

**Before beginning the repair, make sure that both the HDS and the MVCI are updated as listed above.**

**Do only the update listed in this service bulletin.**

Check that the MVCI indicates the applicable program ID listed below (or a later program ID) as the Available Update when the update begins. If the MVCI displays **This vehicle does not need an update at this time** during the update, the software for this service bulletin is already installed.

For more information about updating the HDS, the MVCI, and vehicle systems, refer to Service Bulletin 01-023, *Updating Control Units/Modules*.

Year/Model	Program ID (or later)	Program P/N (or later)	System to Update
2014 Accord Plug-In	37805-5K0-A120	37805-5K0-A120-M1	PGM-FI

**CUSTOMER INFORMATION:** The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.

## WARRANTY CLAIM INFORMATION

The normal warranty applies.

Operation Number	Description	Flat Rate Time	Template ID	Failed Part Number
125517	Update the PGM-FI software.	0.3 hr	14-075a	37820-5K0-A08

Defect Code: 03214

Symptom Code: 03203

Skill Level: Repair Technician

## REPAIR PROCEDURE

Update the PGMI-FI software with the MVCI. Refer to Service Bulletin 01-023, *Updating Control Units/Modules*.

END