



Service Bulletin

File in Section: -

Bulletin No.: PIP5137C

Date: July, 2014

PRELIMINARY INFORMATION

Subject: Rough Idle Or Vibration In Drive

Models: 2014-2015 Chevrolet Silverado
2014-2015 GMC Sierra
With engines 5.3L L83

**This PI was superseded to update Recommendation/Instructions field.
Please discard PIP5137B.**

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

The vehicle may have a rough idle and/or a vibration at idle in gear.

It may also be described as a low idle.

There will not be any DTC with this concern and it will go away just off idle.

Recommendation/Instructions

If this is encountered try centering the engine and trans mount.

If the concern is still there use the following:

For 2014 Silverado and Sierra with 5.3L L83 only built before 07/01/2013

If no change then shim the right engine mount 2 most inner bolts 3mm.

The shims will need to be installed between the mount and the frame.

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
4067150	Engine Mount Replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.