



Service Bulletin

File in Section: -

Bulletin No.: PI0917D

Date: June, 2014

PRELIMINARY INFORMATION

Subject: Brake Squeal or Squeak Noise Intermittently on Initial Brake Applies

Models: 2013-2015 Buick Regal GS
2013-2015 Cadillac ATS Equipped with RPO J55
2013-2015 Cadillac XTS Equipped with RPO J64
2014-2015 Cadillac CTS Sedan (VIN A) Equipped with RPO J55 or J56
2014 Chevrolet SS

This PI has been revised to add the 2015 model year and remove the Corvette. For Corvette, refer to PI1258. Please discard PI0917C.

Condition/Concern

Some customers may comment on a squeal or squeak noise from the front brakes. This condition normally only occurs on initial brake applications after the vehicle has sat for an extended time. The condition occurs typically under light braking, in speeds under 16 km/h (10 mph). After 1-6 brake applies, or after braking at higher speeds, the noise no longer occurs. This condition may occur more often in high humidity conditions.

Recommendation/Instructions

Important: Do not apply the lubricant to the back of the backing plate.

Apply a light coat of the lubricant to completely cover the pad backing plate abutments on each end. The lubricant should not extend onto the friction material. Refer to the illustration below.



Parts Information

Part Number	Description	Qty
19303310 (In Canada, use 19303311)	Lubricant	1

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
2480038*	Apply Lubricant to Front Disc Brake Pads	0.6 hr

*This is a unique Labor Operation for Bulletin use only. It will not be published in the Labor Time Guide.