



Service Bulletin

File in Section: -

Bulletin No.: PIT5165B

Date: December, 2014

PRELIMINARY INFORMATION

Subject: Replacing Power Steering Cooler

Models: 2008 - 2015 Buick Enclave
2009 - 2015 Chevrolet Traverse
2007 - 2015 GMC Acadia
2007 - 2010 Saturn Outlook

This PI was superseded to update Model Years. Please discard PIT5165A.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

When replacing a power steering cooler, perform the following steps to minimize the potential of introducing air into the system:

1. Block off the hoses near the cooler connection with appropriate clamps.
2. Disconnect the cooler from the lines and remove the cooler.
3. Prefill the new cooler on the bench and cap off the pre-filled cooler ends for installation
4. Install the new pre-filled cooler on the vehicle and remove the clamps on the hoses.
5. Follow the Power Steering System Bleed Procedure in service information.

Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
E8940	Power Steering Fluid Cooler Replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.