



Service Bulletin

File in Section: -

Bulletin No.: PIT5231A

Date: July, 2014

PRELIMINARY INFORMATION

Subject: Possible Blank Radio Display And/Or DTC U150F Stored in the Radio/HVAC Controls

Models: 2014-2015 Buick LaCrosse
2013-2015 Cadillac ATS, SRX, XTS
2014-2015 Cadillac CTS (A body), ELR
2015 Cadillac Escalade, ESV
2014-2015 Chevrolet Corvette
2014 Chevrolet Silverado (LD)
2014 GMC Sierra (LD)
2015 Chevrolet Suburban, Tahoe, Silverado
2015 GMC Sierra, Yukon

This PI was superseded to update Model Years. Please discard PIT5231.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

Some customers may complain of a blank radio display and/or a technician may notice DTC U150F stored in the radio/HVAC controls.

Recommendation/Instructions

Please ignore this DTC if it is stored in history with no symptoms reported.

If the DTC is set current, check LIN Bus 5 (circuit 7527) between the Info Display Module and Human Machine Interface (HMI) module for an open, short to ground, short to power, or poor terminal tension.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.