



Service Bulletin

File in Section: -

Bulletin No.: PIC5656C

Date: May, 2014

PRELIMINARY INFORMATION

Subject: Outside Ambient Temperature Display Missing And/Or HVAC Temperature Displays In Celsius B0158

Models: 2012-2014 Buick Verano
2013-2014 Chevrolet Malibu

This PI was superseded to update model years. Please discard PIC5656B.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

A customer or technician may indicate the driver and passenger temperatures settings are displayed in Celsius or the outside ambient temperature is missing from the radio / HVAC display.

This may be caused by the outside ambient temperature sensor being disconnected or the wiring has a fault.

Recommendation/Instructions

Connect the vehicle to the scantool (GDS2) and check instrument panel (IPC) for DTCs. If DTC B0158 Outside Air Temperature Display Malfunction is set check that the outside ambient temperature sensor is connected. If the sensor is connected, check the integrity of circuits 61 and 636 from sensor to the IPC or diagnose B0158 per published Service Information.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.