

© 2016 Mazda Motor of America, Inc.


<b>Subject:</b>  WHITE STAINS FROM UNDER OUTER MIRROR BASE	<b>Bulletin No:</b> 09-046/16
	<b>Last Issued:</b> 08/02/2016

## APPLICABLE MODEL(S)/VINS

2014-2016 Mazda3 (Mexico built)

## DESCRIPTION

Some vehicles may exhibit white stains (A) running down the front door(s) from the base of the outer mirror, causing a poor appearance. This is caused when water enters the mirror base and corrodes the aluminum die cast inside the mirror. To eliminate the concern, the aluminum die cast inside the mirror base has been painted to prevent corrosion.

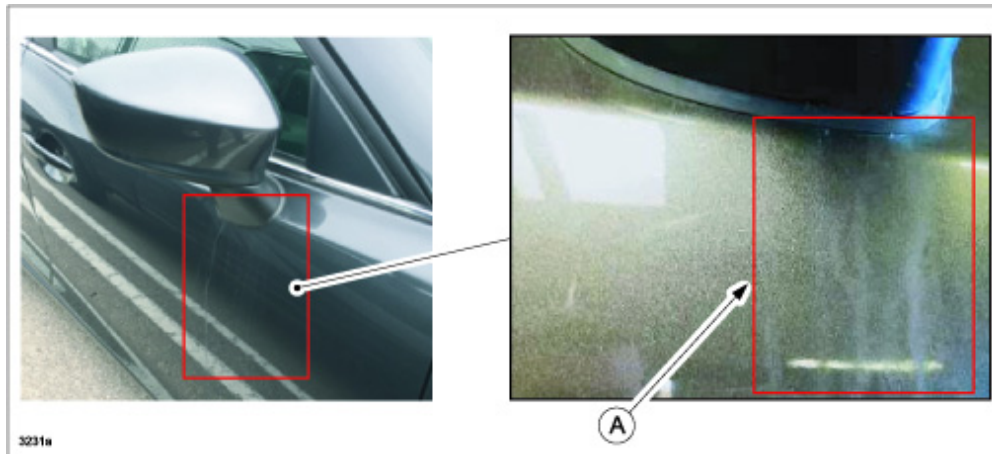

Customers having this concern should have their vehicle repaired using the following repair procedure.

**CONSUMER NOTICE:** The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by „Áúdo-it-yourselfers.„Áú Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

## REPAIR PROCEDURE

1. Verify customer concern.
2. Replace the power outer mirror assembly (both sides) with one used for HOFU plant (Japan built) models according to the instructions on MS3 online (POWER OUTER MIRROR REMOVAL/INSTALLATION).
3. Verify repair.

## PART(S) INFORMATION

Part Number (HOFU plant)	Part Number (Mexico plant)	Description	Qty.	Notes			
				Side	Heater	Side turn lamp	BSM
BHN9-69-121E	BJS7-69-121A	Body, Door Mirror	1	R	-	-	-
BJE3-69-121E	BJS8-69-121A				X	X	-
BHP3-69-121E	BJT1-69-121A				-	-	X
BJD5-69-121E	BJT7-69-121A				X	X	X
BHS2-69-121E	BJT8-69-121A				-	X	-
BJD6-69-121E	BJT9-69-121A				-	X	X
BHN9-69-181E	BJS7-69-181A	Body, Door Mirror	1	L	-	-	-
BJE3-69-181E	BJS8-69-181A				X	X	-
BHP3-69-181E	BJT1-69-181A				-	-	X
BJD5-69-181F	BJT7-69-181A				X	X	X
BHS2-69-181E	BJT8-69-181A				-	X	-
BJD6-69-181E	BJT9-69-181A				-	X	X
GJR9-69-1G1	BJS7-69-1G1	Glass and Holder, Mirror	1	R	-	-	-
GJS2-69-1G1	BJS8-69-1G1				X	-	-
GJS1-69-1G1	BJT1-69-1G1				-	-	X
GJS3-69-1G1	BJT7-69-1G1				X	-	X
GJR9-69-1G7	BJS7-69-1G7	Glass and Holder, Mirror	1	L	-	-	-
GJS2-69-1G7	BJS8-69-1G7				X	-	-
GJS1-69-1G7	BJT1-69-1G7				-	-	X
GJS3-69-1G7	BJT7-69-1G7				X	-	X
L208-69-126	BJS7-69-126	Screw	4	4 required for one side			

Part Number (HOFU plant)	Part Number (Mexico plant)	Description	Qty.	Notes	
				Side	Color
BHN9-69-1N1	BJS7-69-1N1	Housing, Door Mirror	1	R	Black
BHP1-69-1N1-13	BJS9-69-1N1-13				Deep Crystal Blue MC
BHP1-69-1N1-27	BJS9-69-1N1-27				Meteor Gray MC
BHP1-69-1N1-50	BJS9-69-1N1-50				Aluminum Metallic MC
BHP1-69-1N1-51	BJS9-69-1N1-51				Jet Black MC
BHP1-69-1N1-53	BJS9-69-1N1-53				Titanium Flash MC
BHP1-69-1N1-62	BJS9-69-1N1-62				Soul Red MC
BHP1-69-1N1-64	BJS9-69-1N1-64				Snowflake White Pearl
BHP1-69-1N1-83	BJS9-69-1N1-83				Blue Reflex MC
BHN9-69-1N7	BJS7-69-1N7				Housing, Door Mirror
BHP1-69-1N7-13	BJS9-69-1N7-13	Deep Crystal Blue MC			
BHP1-69-1N7-27	BJS9-69-1N7-27	Meteor Gray MC			
BHP1-69-1N7-50	BJS9-69-1N7-50	Aluminum Metallic MC			
BHP1-69-1N7-51	BJS9-69-1N7-51	Jet Black MC			
BHP1-69-1N7-53	BJS9-69-1N7-53	Titanium Flash MC			
BHP1-69-1N7-62	BJS9-69-1N7-62	Soul Red MC			
BHP1-69-1N7-64	BJS9-69-1N7-64	Snowflake White Pearl			
BHP1-69-1N7-83	BJS9-69-1N7-83	Blue Reflex MC			
BHN9-69-1C3	-	Cap	1	R	
BHN9-69-1C9	-	Cap	1	L	-

## WARRANTY INFORMATION

**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty.
- Additional diagnostic time cannot be claimed for this repair.
- The claim must be submitted for DSM authorization.

Warranty Type	A
Symptom Code	98
Damage Code	9Y
Part Number Main Cause	****-69-121 (Body, Door Mirror (R))
Quantity	1
Operation Number / Labor Hours:	XXM5BXRX / 0.7 Hrs. (Both sides)

**NOTE:** Enter other parts in Related Part Numbers.