

Subject: ACCELERATOR PEDAL HINGE BROKEN AT BASE	Bulletin No: 01-013/16
	Last Issued: 05/19/2016

APPLICABLE MODEL(S)/VINS

NOTE: Use GEPC to identify accelerator pedal part number (GHK3-41-600E or GHP9-41-600F) to determine applicable table below.

Vehicles With Kick Down Switch (GHK3-41-600E)

Year	Model	VINs Lower Than	Produced Before
2016	CX-3	JM1 DK ***** 127867	December 07, 2015
	CX-5	JM3 KE ***** 750914	December 07, 2015
	Mazda2	3MD DJ ***** 106755	February 17, 2016
	Mazda3 Japan built	JM1 BM ***** 312477	December 07, 2015
	Mazda3 Mexico built	3MZ BM ***** 288404	February 17, 2016
	Mazda6	JM1 GJ ***** 462664	December 07, 2015

Vehicles Without Kick Down Switch (GHP9-41-600F)


Year	Model	VINs Lower Than	Produced Before
2016	CX-3	JM1 DK ***** 132031	January 12, 2016
	CX-5	JM3 KE ***** 763234	January 12, 2016
	Mazda2	3MD DJ ***** 107151	March 03, 2016
	Mazda3 Japan built	JM1 BM ***** 323107	January 12, 2016
	Mazda3 Mexico built	3MZ BM ***** 289726	March 03, 2016
	Mazda6	JM1 GJ ***** 467333	January 12, 2016

CONSUMER NOTICE: The information and instructions in this bulletin are intended for use by skilled technicians. Mazda technicians utilize the proper tools/equipment and take training to correctly and safely maintain Mazda vehicles. These instructions should not be performed by "do-it-yourselfers." Customers should not assume this bulletin applies to their vehicle or that their vehicle will develop the described concern. To determine if the information applies, customers should contact their nearest authorized Mazda dealership. Mazda North American Operations reserves the right to alter the specifications and contents of this bulletin without obligation or advance notice. All rights reserved. No part of this bulletin may be reproduced in any form or by any means, electronic or mechanical---including photocopying and recording and the use of any kind of information storage and retrieval system ---without permission in writing.

DESCRIPTION

Some vehicles may exhibit the accelerator pedal hinge separating from the base in cold temperatures below 32 degrees Fahrenheit (0 degrees Celsius).

The accelerator pedal has been changed to increase durability.

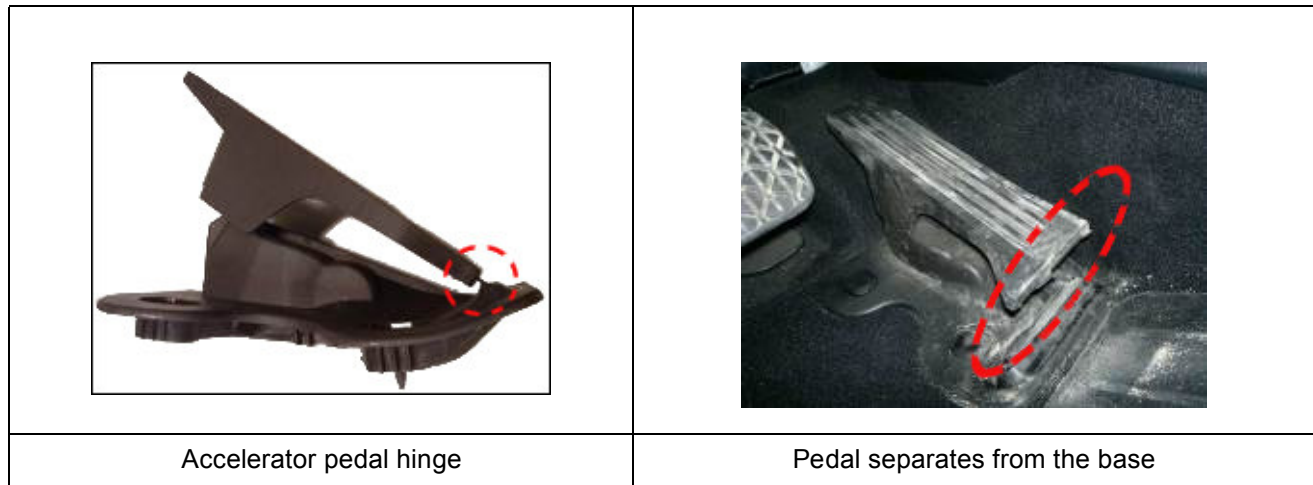

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Replace the accelerator pedal. Refer to MS3 online Workshop Manual section 01-13:
 - CX-3 - ACCELERATOR PEDAL REMOVAL/INSTALLATION
 - CX-5 - ACCELERATOR PEDAL REMOVAL/INSTALLATION
 - Mazda2 - ACCELERATOR PEDAL REMOVAL/INSTALLATION
 - Mazda3 - ACCELERATOR PEDAL REMOVAL/INSTALLATION
 - Mazda6 - ACCELERATOR PEDAL REMOVAL/INSTALLATION
3. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.	Notes
GHK3-41-600E	PEDAL,ACCEL	1	A/T with kick down switch
GHP9-41-600F	PEDAL,ACCEL	1	M/T, A/T without kick down switch

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under:
 - Mazda's New Vehicle Limited Warranty term.
 - California Emission Performance Warranty - where applicable.
 - Partial Zero Emissions Warranty - where applicable.
- This TSB can be performed by D329 Mazda Certified Lube Technicians.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A	
Symptom Code	92	
Damage Code	9A	
Part Number Main Cause	GHK3-41-600E	GHP9-41-600F
Quantity	1	1
Operation Number / Labor Hours:	XXL9SXRX / 0.2 Hrs.	XXM3KXRX / 0.2 Hrs.
TSB can be performed by D329 Mazda Certified Lube Technicians:	Yes	Yes