

Subject: ENGINE OIL SEEPAGE FROM ENGINE OIL PRESSURE SWITCH	Bulletin No: 01-014/15
	Last Issued: 07/14/2015

APPLICABLE MODEL(S)/VINS

- 2016 CX-3
- 2013-16 CX-5
- 2012-13 Mazda3
- 2014-15 Mazda3 (Japan built)
- 2014-15 Mazda3 (Mexico built)
- 2014-16 Mazda6

DESCRIPTION

Frequent engine starts under extremely cold ambient temperatures may result in oil seepage from the engine oil pressure switch. This concern may be caused by a lack of durability of the oil pressure switch under these conditions. To correct the problem, the oil pressure switch has been improved to increase the durability in cold ambient temperatures. All SKYACTIV engines equipped with oil pressure switch part number PE01-18-501A are applicable to this issue.

Customers having this concern should have their vehicle repaired using the following repair procedure.

REPAIR PROCEDURE

1. Verify customer concern.
2. Replace the engine oil pressure switch with a modified one, referring to MS3 online or the Workshop Manual.
3. Verify repair.

PART(S) INFORMATION

Part Number	Description	Qty.
PE01-18-501B	Oil Pressure Switch	1

WARRANTY INFORMATION

NOTE:

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty and California Emission Warranty (short term) or PZEV where applicable.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	76
Damage Code	9E
Part Number Main Cause	PE01 18 501A
Quantity	1
Operation Number / Labor Hours:	XXL4DXRX / 0.4 Hrs.