



SUBJECT:	No: TSB-03-26-002 DATE: August, 2003 MODEL: 2001-03 Montero		
NOISE FROM F			
WHEEL HUB B			
CIRCULATE TO:	[] GENERAL MANAGER	(X) PARTS MANAGER	[X] TECHNICIAN
[X] SERVICE ADVISOR	[X] SERVICE MANAGER	[X] WARRANTY PROCESSOR	[] SALES MANAGER

PURPOSE

This bulletin contains information about improvements to the front wheel hub bearing for certain 2001-03 Montero vehicles.

BACKGROUND INFORMATION

Symptom

While driving, customers may notice a noise from the front wheel bearing(s).

Cause

This bearing noise may be caused by excessive bearing wear because of water penetration into the bearing.

Remedy

If you identify this condition, replace the hub and bearing assembly along with the castle nut with parts supplied in a new front wheel hub/bearing assembly kit.


AFFECTED VEHICLES

2001-03 Montero built before 1/7/2003

Vehicles built after the above date have the new hub/bearing assembly and castle nut installed at the factory.

PROCEDURE

Refer to service manual Group 26 for hub & bearing replacement procedures.

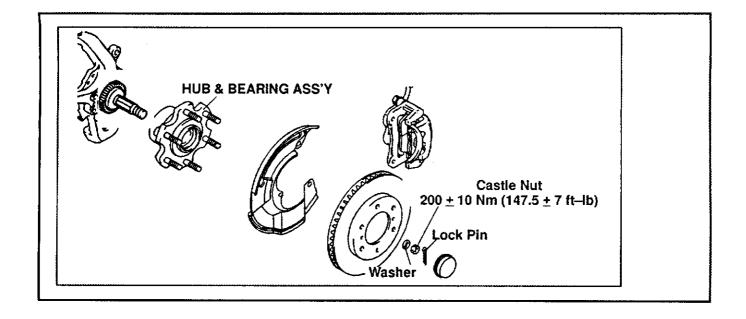

When installing the new hub assembly, make sure the castle nut is tightened to the new torque value (200 \pm 10 Nm [147.5 \pm 7 ft-lb]). The new-style castle nut is modified with a friction coefficient stabilizer and has a green color on its surface.



The modified castle nut, washer, and lock pin cannot be re-used once the nut has been tightened.

PARTS INFORMATION

Use the genuine Mitsubishi Part listed below.

NOTE:

Only one of the kits listed below is required per side.

Part Number	Description	Remarks	
MN103586	Hub & Bearing Assembly Kit	Kit Contents: 1. Hub & Bearing Assembly (MR594954) 2. Modified Castle Nut (MN103380) 3. Washer 4. Lock Pin	
*MN103433 * <i>NOTE: Use this kit if you already have the</i> MR594954 hub/bearing in stock.	Castle Nut Kit	Kit Contents: 1. Modified Castle Nut (MN103380) 2. Washer 3. Lock Pin	

WARRANTY INFORMATION

Repair on a customer complaint basis ONLY. This bulletin is for information only, not warranty authorization.

Front Wheel Hub Replacement (One Side)				
Nature Code: 80D	Cause Code: 990			
Labor Operation No. 26614110	Time Allowance: 1.1 hrs. (one side)			
Warranty Coverage: 60 months/60,000 miles.				
Special Warranty Information: Normal warranty procedures apply.				

Ν	1itsu	ıbishi	Motors	North	America.	Inc.