



MEDIC UPDATE

TECHNICAL SERVICE BULLETIN

SUBJECT: BRAKE NOISE				No: TSB-03-35-003
				DATE: November, 2003
				MODEL: 2002-03 Lancer
CIRCULATE TO:	<input type="checkbox"/> GENERAL MANAGER	<input checked="" type="checkbox"/> PARTS MANAGER	<input checked="" type="checkbox"/> TECHNICIAN	
<input checked="" type="checkbox"/> SERVICE ADVISOR	<input checked="" type="checkbox"/> SERVICE MANAGER	<input type="checkbox"/> WARRANTY PROCESSOR	<input type="checkbox"/> SALES MANAGER	

PURPOSE

Some customers may complain of a clicking, squealing, or groaning noise when braking.

- To minimize a clicking noise, new, improved front shims are available. The new shims have a rubber covering for noise prevention.
- To minimize a squealing or groaning noise, new, improved front brake pads are available. The new brake pads are made of improved material which minimizes noise.

AFFECTED VEHICLES

2002-03 Lancer

PROCEDURE

1. Test drive the vehicle.
2. Listen carefully for abnormal noises when braking.
 - a. If there is a clicking noise when braking, replace the front shims. Install the new, improved shims listed in the PARTS INFORMATION section of this bulletin.
 - b. If there is a squealing or groaning noise when braking, replace the front brake pads. Install the new, improved pads listed in the PARTS INFORMATION section of this bulletin.

PARTS INFORMATION

Use the new, improved Genuine Mitsubishi Parts listed below:

Description	Part Number
Shim set, front brakes	MN116605
Pad set, front brakes	MN116604

066077

WARRANTY INFORMATION

Install the new parts listed in this bulletin on a customer complaint basis only.

Mitsubishi Motors North America, Inc.
