



Michael A. Berardi
 Director
 Service Engineering Operations
 Ford Customer Service Division

Ford Motor Company
 P. O. Box 1904
 Dearborn, Michigan 48121

April 3, 2017

TO: All U.S. Ford and Lincoln Dealers

SUBJECT: **NEW VEHICLE DEMONSTRATION / DELIVERY HOLD – Safety Recall 15S21 – Supplement #5**
 Certain 2005-2006 Model Year Ford GT and 2005-2014 Model Year Mustang Vehicles
 Driver Airbag Inflator or Driver Airbag Module Replacement

New! REASON FOR THIS SUPPLEMENT

- *Owner Notification Mailing Schedule*
 - *All remaining owners of affected 2013-2014 Mustang (non-Shelby GT500) vehicles will be notified the week of April 10, 2017.*
- *Parts Requirements / Ordering Information:*
 - *Part number CR3Z-63043B13-AB has been superseded to CR3Z-63043B13-AD. Either part may be used to repair 2013-2014 Mustang (non-Shelby GT500) vehicles.*
 - *Parts to repair all affected vehicles are now available for open ordering.*

AFFECTED VEHICLES

Vehicle	Model Year	Assembly Plant	Build Dates
Ford GT	2005-2006	Wixom	February 20, 2004 through September 22, 2006
Mustang	2005-2014	Flat Rock	April 6, 2004 through June 21, 2014

Affected vehicles are identified in OASIS and FSA VIN Lists.

REASON FOR THIS SAFETY RECALL

Takata has determined that the airbag inflator propellant wafers in some inflators may experience an alteration over time, which could potentially lead to an over-aggressive combustion in the event of a crash that requires airbag deployment. This potential condition could create excessive internal pressure when the airbag is deployed, which could result in the body of the inflator rupturing upon deployment increasing the risk of injury to occupants.

SERVICE ACTION

- Before demonstrating or delivering 2005-2006 Ford GT and 2005-2012 Mustang vehicles, dealers are to replace the driver airbag inflator.
- Before demonstrating or delivering any new in-stock 2013-2014 Mustang vehicles, dealers are to replace the driver airbag module.

NOTE: All replaced driver airbag inflators and driver airbag modules must be returned for analysis.

NOTE: All vehicles that were previously repaired under Safety Recall 14B09 will also require driver airbag inflator replacement, as directed by this safety recall.

This service must be performed on all affected vehicles at no charge to the vehicle owner.

New! OWNER NOTIFICATION MAILING SCHEDULE

Owners of affected 2005-2006 Ford GT and 2005-2012 Mustang vehicles were mailed between May 16, 2016 and July 22, 2016.

Owner letters were mailed to some 2013-2014 Mustang (all models) customers the week of January 16, 2017.

Owners of affected 2013-2014 Mustang Shelby GT500 vehicles were mailed the week of February 27, 2017.

Owners of all remaining affected 2013-2014 Mustang (non-Shelby GT500) vehicles will be notified the week of April 10, 2017.

Dealers should repair any affected vehicles that arrive at their dealerships, whether or not the customer has received a letter.

PLEASE NOTE:

Federal law requires dealers to complete this recall service before a new vehicle is delivered to the buyer or lessee. Violation of this requirement by a dealer could result in a civil penalty of up to \$21,000 per vehicle. Correct all vehicles in your new vehicle inventory before delivery.

ATTACHMENTS

Attachment I: Administrative Information
Attachment II: Labor Allowances and Parts Ordering Information
Attachment III: Technical Information
Attachment IV: Regional Core Recovery Center (RCRC) Airbag Inflator Return Process
Attachment V: Dealer Q & A
Owner Notification Letter

QUESTIONS & ASSISTANCE

For questions and assistance, contact the Special Service Support Center (SSSC) via the SSSC Web Contact Site. The SSSC Web Contact Site can be accessed through the Professional Technician Society (PTS) website using the SSSC link listed at the bottom of the OASIS VIN report screen or listed under the SSSC tab.

Sincerely,



Michael A. Berardi

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD – Safety Recall 15S21 – Supplement #5
Certain 2005-2006 Ford GT and 2005-2014 Mustang Vehicles
Driver Airbag Inflator or Driver Airbag Module Replacement

OASIS ACTIVATION

OASIS was activated on June 4, 2015.

FSA VIN LISTS ACTIVATION

FSA VIN Lists were available through <https://web.fsavinlists.dealerconnection.com> on June 4, 2015.

Owner names and addresses became available on August 1, 2016.

NOTE: Your FSA VIN Lists may contain owner names and addresses obtained from motor vehicle registration records. The use of such motor vehicle registration data for any purpose other than in connection with this recall is a violation of law in several states, provinces, and countries.

Accordingly, you must limit the use of this listing to the follow-up necessary to complete this recall.

SOLD VEHICLES

- Owners of affected vehicles will be directed to dealers for repairs.
- Immediately contact any of your affected customers whose vehicles are not on your VIN list but are identified in OASIS. Give the customer a copy of the Owner Notification Letter (when available) and schedule a service date.
- Correct other affected vehicles identified in OASIS which are brought to your dealership.
- Dealers are to prioritize repairs of customer vehicles over repairs of new and used vehicle inventory.

STOCK VEHICLES

- Correct all affected units in your new vehicle inventory before delivery.
- Use OASIS to identify any affected vehicles in your used vehicle inventory.

TITLE BRANDED / SALVAGED VEHICLES

Affected title branded and salvaged vehicles are eligible for this recall.

ADDITIONAL REPAIR (LABOR TIME AND/OR PARTS)

Additional repairs identified as necessary to complete the FSA should be managed as follows:

- For vehicles within new vehicle bumper-to-bumper warranty coverage, follow existing warranty and policy guidelines for related damage claims. No SSSC approval is required for these vehicles:
 - Ford vehicles – 3 years or 36,000 miles
- For vehicles outside new vehicle bumper-to-bumper warranty coverage, submit an Approval Request to the SSSC Web Contact Site prior to completing the repair.

OWNER REFUNDS

Refunds are not approved for this program.

RENTAL VEHICLES

The use of rental vehicles is not approved for this program.

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD – Safety Recall 15S21 – Supplement #5
Certain 2005-2006 Ford GT and 2005-2014 Mustang Vehicles
Driver Airbag Inflator or Driver Airbag Module Replacement

CLAIMS PREPARATION AND SUBMISSION

- Enter claims using Direct Warranty Entry (DWE) or One Warranty Solution (OWS).
 - DWE: refer to ACESII manual for claims preparation and submission information.
 - OWS: when entering claims in DMS software, select claim type 31: Field Service Action. The FSA number (15S21) is the sub code.

NOTE: The serial number of the new airbag inflator must be provided to Ford for the claim to be processed, including all 2013-2014 Mustang vehicles. The Technical Information in this bulletin advises technicians to document the new airbag inflator serial number on the repair order. Enter the 13-character serial number of the new airbag inflator in the claim as follows:

- For claims submitted using DMS or OWS on-line, enter the serial number in the Test Results Section.
 - Select DTC REQUIRED MEASUREMENT OR RESULTS from the drop down list.
 - Enter the serial number in the CODE field.
- For claims submitted using ACESII on-line, enter the serial number on the ACESII DIAG CODE ENTRY screen.
 - MIL ON = N
 - Enter the serial number in the OTHER field.
- Additional labor and/or parts must be claimed as related damage on a separate repair line from the FSA.

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD – Safety Recall 15S21 – Supplement #5

Certain 2005-2006 Ford GT and 2005-2014 Mustang Vehicles

Driver Airbag Inflator or Driver Airbag Module Replacement

LABOR ALLOWANCES

Vehicle	Description	Labor Operation	Labor Time
2005-2006 Ford GT	Replace Driver Airbag Inflator	15S21B	0.4 Hours*
2005-2012 Mustang			
2013-2014 Mustang	Replace Driver Airbag Module	15S21C	0.4 Hours

* It is no longer necessary to follow the WSM SRS Depowering and Repowering steps when performing the service procedure. Refer to Attachment III - Technical Information.

New! PARTS REQUIREMENTS / ORDERING INFORMATION

Part Number	Vehicle	Description	Order Quantity
5R3Z-63043B13-C	2005-2006 Ford GT	Driver Airbag Inflator	1
	2005-2012 Mustang		
CR3Z-63043B13-AD	2013-2014 Mustang (non-Shelby GT500)	Driver Airbag Module	1
DR3Z-63043B13-AD	2013-2014 Mustang (Shelby GT500)	Driver Airbag Module	1

The DOR/COR number for this program is 51036.

Parts to repair all affected vehicles are now available for open ordering.

Order your parts through normal order processing channels. To guarantee the shortest delivery time, an emergency order for parts must be placed.

To ensure all 2013-2014 non-Shelby GT500 Mustang vehicles in HAH states are repaired as soon as possible, a seed stock of part number CR3Z-63043B13-AB (*superseded to CR3Z-6304B13-AD*) was provided to dealers located in Alabama, Florida, Georgia, Hawaii, Louisiana, Mississippi, and Texas. Beginning the week of October 31, 2016, dealers in these states received parts equal to approximately 20% of the vehicles assigned to them on their FSA VIN List. Each of these dealers received at least one driver airbag module.

An additional seed stock of part number CR3Z-63043B13-AB was provided to all US dealers during the month of December 2016. Dealers received parts equal to approximately 10% of the vehicles assigned to them on their FSA VIN List. Each dealer received at least one driver airbag module at that time.

DEALER PRICE

For latest prices, refer to DOES II.

NEW VEHICLE DEMONSTRATION / DELIVERY HOLD – Safety Recall 15S21 – Supplement #5
Certain 2005-2006 Ford GT and 2005-2014 Mustang Vehicles
Driver Airbag Inflator or Driver Airbag Module Replacement

PARTS RETENTION AND RETURN

NOTE: All replaced driver airbag inflators and driver airbag modules must be returned in the new part box. If the new part box is damaged or lost, contact Miguel Prigadaa at 210-250-5078 or SCTakataRestraints_International@xpo.com for a replacement box.

NOTE: RCRC will only pick-up parts that have a corresponding FCS-700 Tag.

- Part return instructions for **dealers in the lower 48 United States:**
 - Dealers must monitor their PEARS register. A FCS-700 tag will be generated for each driver airbag inflator and driver airbag module. Parts will be picked up by the RCRCs.
 - The RCRC will not pick up parts that are not properly packaged in the new part box.
 - Refer to Attachment IV for specific part return instructions and documentation.
 - Disregard prepaid FedEx shipping instructions that may be included in new part boxes.

NOTE: *If a FCS-700 Tag is not issued, or the PEARS register directs to “Scrap” a part replaced under this safety recall, please submit a General Request to the SSSC Web Contact Site stating that you were directed to scrap a part.*

- Part return instructions for **dealers outside of the lower 48 United States:**
 - Continue to follow the previous FedEx part return process of contacting Miguel Prigadaa at 210-250-5078 or Miguel.Prigadaa@email.xpo.com.
- Follow the provisions of the Warranty and Policy Manual, Section 1 “WARRANTY PARTS RETENTION AND RETURN POLICIES.”

EXCESS STOCK RETURN

Excess stock returned for credit must have been purchased from Ford Customer Service Division in accordance with Policy Procedure Bulletin 4000.

CERTAIN 2005-2006 FORD GT AND 2005-2014 MUSTANG VEHICLES — DRIVER AIRBAG INFLATOR OR DRIVER AIRBAG MODULE REPLACEMENT

OVERVIEW

Takata has determined that the air bag inflator propellant wafers in some inflators may experience an alteration over time, which could potentially lead to an over-aggressive combustion in the event of an airbag deployment. This potential condition could create excessive internal pressure when the airbag is deployed, which could result in the body of the inflator rupturing upon deployment increasing the risk of injury to occupants. Dealers are to replace the driver airbag inflator or driver airbag module as directed. **The serial number from the *new* airbag inflator must be recorded on the repair order.** The replaced driver airbag inflator or driver airbag module will be placed into the packaging from the *new* part to be returned to Takata.

SERVICE PROCEDURE

 **WARNING:** Failure to follow the instructions and warnings in the Workshop Manual may result in injury.

NOTE: If the Airbag Readiness light indicates no Supplemental Restraint System (SRS) faults are present, it is not necessary to follow the WSM SRS Depowering and Repowering steps when performing this service procedure. Turn the ignition to OFF and wait 1 minute, then it is safe to proceed with airbag inflator or airbag module replacement.

NOTE: The ignition must remain OFF until this service procedure is completed.

1. Determine the appropriate service action.

- 2013-2014 Mustang (all) - Replace driver airbag module - Page 2.
- 2005-2006 Ford GT and 2005-2012 Mustang - Replace driver airbag inflator - Page 3.



2013-2014 Mustang (all) – Replace Driver Airbag Module

NOTE: The serial number of the *new* airbag inflator must be provided to Ford for the warranty claim to be processed.

1. Record the 13 character serial number of the *new* airbag inflator on the repair order. The inflator is pre-installed in the *new* airbag module. See Figure 1.



FIGURE 1

NOTE: If the Airbag Readiness light indicates no Supplemental Restraint System (SRS) faults are present, it is not necessary to follow the WSM SRS Depowering and Repowering steps when performing this service procedure. Turn the ignition to OFF and wait 1 minute, then it is safe to proceed with airbag module replacement.

NOTE: The ignition must remain OFF until this service procedure is completed.

2. Replace the driver airbag module. Please follow the Workshop Manual (WSM) procedures in Section 501-20B.

NOTE: Confirm that the Airbag Readiness light still indicates no SRS faults are present.

3. Package the replaced airbag module in the *new* part box and provide to the appropriate dealership personnel for part returns.



2005-2006 Ford GT and 2005-2012 Mustang - Replace Driver Airbag Inflator

NOTE: If the Airbag Readiness light indicates no Supplemental Restraint System (SRS) faults are present, it is not necessary to follow the WSM SRS Depowering and Repowering steps when performing this service procedure. Turn the ignition to OFF and wait 1 minute, then it is safe to proceed with airbag module replacement.

NOTE: The ignition must remain OFF until this service procedure is completed.

1. Remove the driver airbag from the vehicle. Please follow the Workshop Manual (WSM) procedures in Section 501-20B.

2. Set the airbag face down onto a surface that will not scratch or damage the airbag face.

WARNING: Do not allow any debris on or around the airbag once the inflator is removed.

3. Remove and discard the four airbag inflator retaining nuts from the driver side airbag. See Figure 2.

4. **NOTE:** In order to verify the correct airbag inflator is installed, mark the old airbag inflator with a felt tip marker prior to removal.

Remove the airbag inflator and set aside for return shipping. See Figure 2.

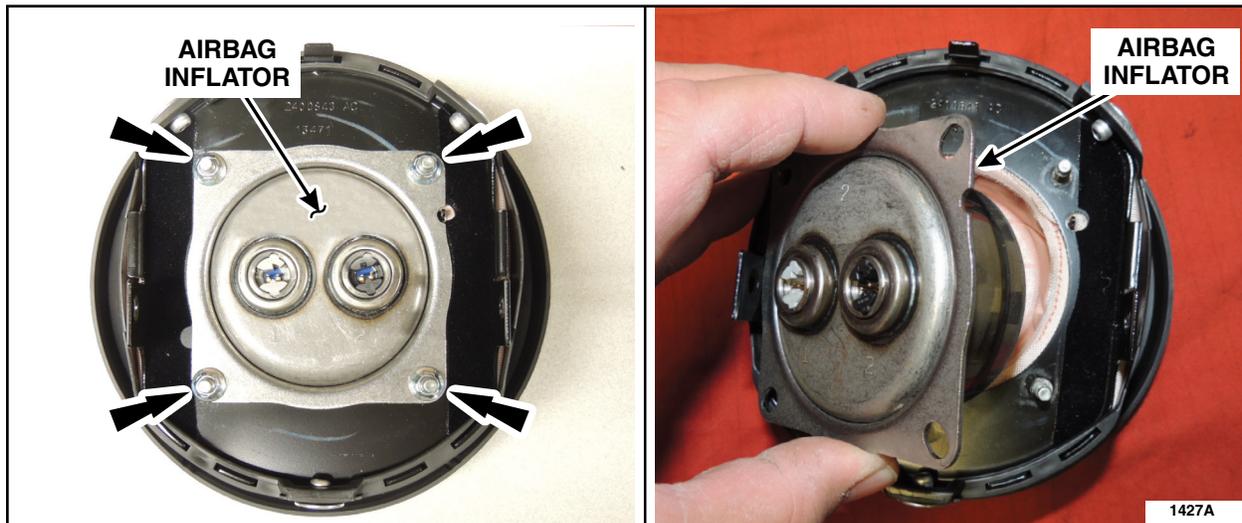


FIGURE 2

NOTE: The serial number of the *new* airbag inflator must be provided to Ford for the warranty claim to be processed.

5. Record the 13 character serial number of the *new* airbag inflator on the repair order. See Figure 1.



6. Align the key on the driver airbag with the slot on the *new* inflator. Install the *new* inflator into the driver airbag. See Figure 3.

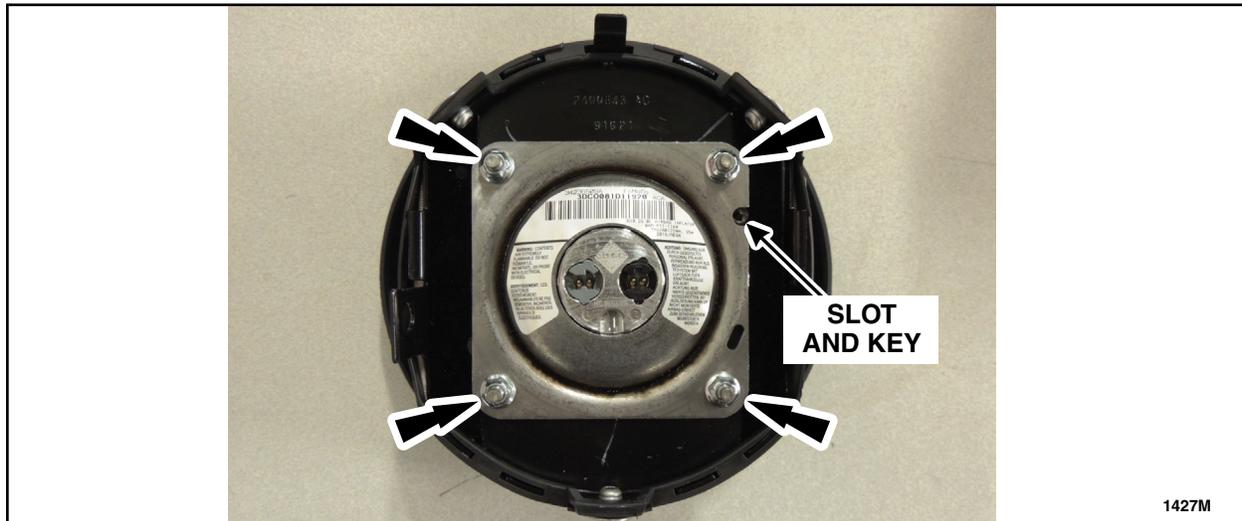


FIGURE 3

7. Install four *new* airbag inflator nuts onto the driver airbag. See Figure 3.

- Tighten to 6.5 Nm (57 lb-in).

8. Re-install the driver airbag. Please follow the WSM Procedures in Section 501-20B.

NOTE: Confirm that the Airbag Readiness light still indicates no SRS faults are present.

9. Package the replaced inflator in the *new* part box and provide to the appropriate dealership personnel for part returns.



**REGIONAL CORE RECOVERY CENTER
AIRBAG INFLATOR AND AIRBAG MODULE RETURN PROCESS**

PART RETURN INSTRUCTIONS AND SHIPPING DOCUMENTATION

The Regional Core Recover Center (RCRC) will only pick up airbag inflators and airbag modules with a corresponding FCS-700 tag, and the replaced part must be packaged in the box from the new part. A FCS-700 tag will be generated for each part on claims paid on or after May 10, 2016.

NOTE: Airbag inflators and airbag modules that do not have FCS-700 tags must be returned utilizing the previous return process; RCRC's will not accept any parts that do not have FCS-700 tags.

NOTE: If the new part box is damaged or lost, contact Miguel Prigadaa at 210-250-5078 or SCTakataRestraints_International@xpo.com for a replacement box.

Print and provide both of the following completed documents to the RCRC driver:

1. Hazardous Materials Shipping Document (Page 2)
 - a. In the box titled Shipper, enter your dealership name and address.
 - b. In the box titled Receiver, enter the address of your Regional Core Recovery Center.
NOTE: Page 4 contains a list of RCRC locations. If you are unsure of which RCRC location serves your dealership, consult the RCRC driver.
 - c. In the box titled Number/Type of Package, enter the number of boxed inflators.
 - d. In the box titled Weight, enter the total shipment weight of all boxed inflators.
 - e. At the bottom of the Hazardous Materials Shipping Document, complete the Shipper's Certification
2. North American Emergency Response Guide 171 (Page 3)

HAZARDOUS MATERIALS SHIPPING DOCUMENT – GROUND TRANSPORTATION

SHIPPER	RECEIVER
Dealership Name:	Ford Motor Company
	Regional Core Recovery Center
Address:	Address:
Phone:	Phone:
24-HOUR EMERGENCY CONTACT: INFOTRAC 1-800-535-5053 (Domestic) 1-352-323-3500 (International)	

General Instructions: Pursuant to 49 CFR each person who offers a hazardous material for transportation shall perform the following pre- transportation functions: (1) Determine the hazard class of the material (2) Select authorized hazmat packaging (3) Fill hazmat packaging (4) Properly close hazmat packaging (5) Properly mark the package (6) Properly label the package (7) Prepare shipping document (8) Provide and maintain emergency response information (9) Review shipping paper to verify compliance to 49 CFR (10) Sign shipping document to certify shipment is in conformance to 49 CFR (11) Load hazardous material in transport vehicle (12) Segregate hazardous material from incompatible cargo (13) Select, provide or affix placards to transport vehicle to indicate that it holds hazardous materials.

Also, pursuant to 49 CFR an employer must ensure any employee performing any function affecting the transport of hazardous materials must be appropriately trained for the function the employee performs and must be retrained every thirty-six months.

DOT Shipping Description		
Number/Type of Package	UN Number, Proper Shipping Name, Hazard Class, Packing Group	Weight
Box(es)	UN3268, Safety Devices, Class 9	Lbs.

Shipper's Certification (49 CFR 172.204): This is to certify that the above named materials are properly classified, described, packaged, marked and labeled and are in proper condition for transportation according to the applicable regulations of the Department of Transportation.

NAME: _____ **SIGNATURE:** _____ **DATE:** _____

<p>ERG2012 SUBSTANCES (LOW TO MODERATE HAZARD) GUIDE 171</p>	<p>ERG2012 SUBSTANCES (LOW TO MODERATE HAZARD) GUIDE 171</p>
<p>EMERGENCY RESPONSE</p> <p>FIRE:</p> <ul style="list-style-type: none"> • Small Fire • Dry chemical, CO₂, water spray or regular foam. • Large Fire • Water spray, fog or regular foam. • Do not scatter spilled material with high pressure water streams. • Move containers from fire area if you can do it without risk. • Dike fire-control water for later disposal. <p>Fire Involving Tanks</p> <ul style="list-style-type: none"> • Cool containers with flooding quantities of water until well after fire is out. • Withdraw immediately in case of rising sound from venting safety devices or discoloration of tank. • ALWAYS stay away from tank's engulfed in fire. 	<p>POTENTIAL HAZARDS</p> <p>FIRE OR EXPLOSION:</p> <ul style="list-style-type: none"> • Some may burn but none ignite readily. • Containers may explode when heated. • Some may be transported hot. <p>HEALTH:</p> <ul style="list-style-type: none"> • Inhalation of material may be harmful. • Contact may cause burns to skin and eyes. • Inhalation of Asbestos dust may have a damaging effect on the lungs. • Fire may produce irritating, corrosive and/or toxic gases. • Some liquids produce vapors that may cause dizziness or suffocation. • Runoff from fire control may cause pollution. <p>PUBLIC SAFETY</p> <ul style="list-style-type: none"> • CALL EMERGENCY RESPONSE telephone Number on Shipping Paper first, if Shipping Paper not available or no answer, refer to appropriate telephone number listed on the inside back cover. • As an immediate precautionary measure, isolate spill or leak area in all directions for at least 50 meters (150 feet) for liquids and at least 25 meters (75 feet) for solids. • Stay upwind.
<p>SPILL OR LEAK</p> <ul style="list-style-type: none"> • Do not touch or walk through spilled material. • Stop leak if you can do it without risk. • Prevent dust cloud. • Avoid inhalation of asbestos dust. <p>Small Dry Spill</p> <ul style="list-style-type: none"> • With clean shovel place material into clean, dry container and cover loosely. move containers from spill area. <p>Small Spill</p> <ul style="list-style-type: none"> • Take up with sand or other non-combustible absorbent material and place into containers for later disposal. <p>Large Spill</p> <ul style="list-style-type: none"> • Dike far ahead of liquid spill for later disposal. • Cover powder spill with plastic sheet or tarp to minimize spreading. • Prevent entry into waterways, sewers, basements or confined areas. 	<p>PROTECTIVE CLOTHING</p> <ul style="list-style-type: none"> • Wear positive pressure self-contained breathing apparatus (SCBA). • Structural firefighters' protective clothing will only provide limited protection. <p>EVACUATION</p> <p>Spill</p> <ul style="list-style-type: none"> • See Table 1 - Initial Isolation and Protective Action Distances for highlighted materials. For non-highlighted materials, increase, in the downwind direction, as necessary, the isolation distance shown under "PUBLIC SAFETY". <p>Fire</p> <ul style="list-style-type: none"> • If tank, rail car or tank truck is involved in a fire, ISOLATE for 800 meters (1/2 mile) in all directions; also, consider initial evacuation for 800 meters (1/2 mile) in all directions.
<p>FIRST AID</p> <ul style="list-style-type: none"> • Move victim to fresh air. • Call 911 for emergency medical service. • Give artificial respiration if victim is not breathing. • Administer oxygen if breathing is difficult. • Remove and isolate contaminated clothing and shoes. • In case of contact with substance, immediately flush skin or eyes with running water for at least 20 minutes. • Ensure that medical personnel are aware of the material(s) involved and take precautions to protect themselves. 	<p>Page 280</p>

RCRC Locations

RCRC CODE	Address	City	State	Zip
00708	TRI COUNTY COMMERCE PARK, BLDG. 3/3A, 2511 LOVI ROAD	FREEDOM	PA	15042
01183	20501 PENNSYLVANIA ROAD STE 140	BROWNSTOWN Twp	MI	48192
01326	9040 BURROUGH DOVER LANE	PENNSAUKEN	NJ	08110
01728	3700 CLAYMOORE PK. DR., S. 160	HOUSTON	TX	77043
01729	5915 CORRIDOR PARKWAY	SCHERTZ	TX	78154
02276	4300 ROUND LAKE ROAD W. UNIT 200	ARDEN HILLS	MN	55112
02454	1605 SURVEYOR BLVD.	CARROLLTON	TX	75006
03001	8333 WASHINGTON PL NE Suite E	ALBUQUERQUE	NM	87113
03199	7103 E. 47TH AVE.	DENVER	CO	80216
04861	5503 F ST	OMAHA	NE	68117
05399	3421 W. WELDON.	PHOENIX	AZ	85017
05495	4161 DIXON AVE	DES MONIES	IA	50313
05514	3645 DEVELOPERS RD.	INDIANAPOLIS	IN	46227
06201	3737 S. CAPITOL AVE.	WHITTIER	CA	90601
06583	600 SOUTH THERESA AVE.	ST LOUIS	MO	63103
06586	4444 SOUTH BLVD.	CHARLOTTE	NC	28209
06615	8242 SANDY COURT	JESSUP	MD	20794
06952	7145 INDUSTRIAL	EL PASO	TX	79915
06953	550 GILLS DRIVE	ORLANDO	FL	32824
06954	5286 GEORRGIA HWY 85, SUITE 200	FOREST PARK	GA	30297
06955	545 FORD AVE	JACKSON	MS	39209
06959	900 W. MAIN	OKLAHOMA CITY	OK	73106
07089	4304 EUBANK ROAD	RICHMOND	VA	23231
08263	11 CHAPIN RD, UNIT A	PINE BROOK	NJ	07058
08453	18637 72nd AVE S	KENT	WA	98032
08454	5220 N. E. 152ND PLACE	PORTLAND	OR	97230
08587	2999 MILLER STREET	SAN LEANDRO	CA	94577
08731	8250 NE UUNDERGROUND DRIVE PILLAR 153	KANSAS CITY	MO	64161
08858	2333 S. 1800 WEST	WEST VALLEY CITY	UT	84119
09001	3311 CORPORATE DR.	JOLIET	IL	60431
09121	444 WHITNEY ST	NORTHBOROUGH	MA	01532
09252	1901 LEMOYNE AVE.	SYRACUSE	NY	13208

DEMONSTRATION / DELIVERY HOLD – Safety Recall 15S21 – Supplement #4
Certain 2005-2006 Ford GT and 2005-2014 Mustang Vehicles
Driver Airbag Inflator or Driver Airbag Module Replacement

DEALER Q & A

- Q1. 14B09 has previously been performed on a 2005-2006 Ford GT or 2005-2008 Mustang vehicle. Why is the same vehicle also affected by 15S21?**
- A. Safety Recall 15S21 utilizes a redesigned part for a final repair. 14B09 was an interim repair using a "like for like" part that must be replaced under safety recall 15S21.
- Q2. Can the airbag inflator part number provided in 14B09 be used to complete repairs under 15S21?**
- A. No, the parts used in 14B09 and 15S21 are not equivalent. Use only part number(s) listed in 15S21 (or latest level replacements) for this final repair.
- Q3. Can dealers perform repairs on 2013-2014 Mustang Shelby GT500 vehicles now?**
- A. Yes, 2013-2014 Mustang Shelby GT500 vehicles can now be repaired with a unique part.
- Q4. Can airbag inflator (5R3Z-63043B13-C) be installed in 2013-2014 Mustang vehicles?**
- A. No, the driver airbag system in 2013-2014 Mustang vehicles is unique. The entire driver airbag module assembly must be installed in these vehicles.
- Q5. Does the airbag inflator serial number on 2013-2014 Mustang vehicles have to be provided to Ford?**
- A. Yes. The airbag inflator serial number is clearly visible on the airbag module assembly. Claims will not be processed without the serial number. Refer to Attachment I – Claims Preparation and Submission and Attachment III – Technical Information.
- Q6. What do I do with old level parts?**
- A. Old parts (5R3Z-63043B13-A) can be returned via the FSA parts return process. Please use "CG" as the claim code and note in the shipper field the FSA bulletin number (15S21).
- Q7. When will complete driver airbag modules be available for 2005-2006 Ford GT and 2005-2014 Mustang crash repairs?**
- A. Complete driver airbag modules are available for all 2005-2014 Mustang vehicles. We are working diligently to make complete driver airbag modules for 2005-2006 Ford GT vehicles available as quickly as possible. Additional information will be posted on DOESII as it becomes available.